

INSPECTION REPORT FOR FLOOD /RAIN DAMAGE ROAD		
Name of Scheme: <u>Pradhan Mantri Road Balu Ram Lakhan to SHW Pyrnedew Ram</u>		
Hazards	Flood/Rain	Actual Length (in km): <u>3.435</u>
Division: <u>Triveniganj</u>	District: <u>Supaul</u>	
Damage Length (in km): <u>0.06</u>	Damages Location/Chainage:	
Name of Scheme/Programme:	<u>FDR</u>	
Status of Project:	Under Agreement/Out of Agreement - <u>Out of Agreement</u>	
Sr. No.	Parameters to be Checked in Restoration work	Remarks : (S/U)
1.	Pavement (BT/CC)	-
a)	Condition of Surfacing	-
Description of observation : <u>20mm mix Seal surface in 60m length - done, satisfactory.</u>		
b)	Adequate Thickness of pavement layers constructed	-
Description of observation : <u>20mm mix Seal surface</u>		
c)	Quality of Construction Material Used	-
Description of observation :		
d)	Whether free from any defects and Irregularity example- Surface Cracks, Undulation, exposed aggregates in case of CC Pavement, Poor workmanship, etc.	<u>U</u>
Description of observation : <u>fully defective Protection wall constructed & it is getting damage.</u>		
e)	Compaction of flanks/ slope & raincuts	<u>U</u>
Description of observation : <u>provision of E/W in flank in 60m but it is not done.</u>		
2	Cross Drainage Structure	
a)	Condition of head walls in Hume pipe culverts	-
b)	Condition of Vent Clearance	-
c)	Condition of railings/Slab/approach for Bridges	-
Description of observation of CD works : <u>In the DPR, there is provision of Protection wall in 60m length. At site constructed wall length, is 32M (left), 20.10M (Right) 12.50M (Right). In this 12.50M wall is tilted and broken stage.</u>		
Remark if any: <u>Protection wall (constructed) is not as per section (Size) of sanctioned Estimate. Top width of wall is found 0.25m instead of 0.40m provision. In 12.50m length wall is fallen.</u>		

Overall Rating

Satisfactory (S) / Unsatisfactory (U)

U

Name of Officer: Ram Prabesh Saw

Designation:

T. A. R. W. D
Works Circle
Siwan.

22/7/21
AE.

(Signature)

22.7.21