

Inspection Report of Flood Damage work

me of PIUs:- RWD Works Division, Darbhanga1 Inspected By Benipur

me of Block/Road:- HAYAGHAT/ Balia Brick bhatta to Navtoli'a


For Road

1. Damage Location Chainage:- 0 km to 0.495 km
2. Damage Length :- 270.90 m
3. Nature of Damage :- Surface Damage
4. Details of Restoration Works
 - i. Material being used in Restoration works:- Brick Bats
 - ii. Equipment's /Tools being used in Restoration works:- JCB/ Tractor/ Labour's
 - iii. Procedure taken up in Restoration works:- Laying of Brick Bats with Light Ramming
 - iv. Restored Length:- 270.90 m

For Bridge

1. Damage Location Chainage:-
 2. Damage Length :-
 3. Nature of Damage :-
 4. Details of Restoration Works
 - i. Material being used in Restoration works:-
 - ii. Equipment's /Tools being used in Restoration works:-
 - iii. Procedure taken up in Restoration works:-
 - iv. Restored Length:-
- N/A

Work Found satisfactory



Signature of JE/AE/EE

Signature
(Name of Inspection)

Benipur

ABSTRACT

**Road Name- Temporary Restoration of Road from Balia Brick bhattha
To Navtoliya**

Block- HAYAGHAT

RWD (W) DIVISION DARBHANGA -1

Road Actual Length - 0.495 KM

Effectd Road Length - ~~272.00 M.~~ 270.90 M

S.No.		UNIT	QUANTITY	RATE	AMOUNT (Rs)
1	Providing and filling bricks bats in ditches including cost of bricks bats and labour all complete job as per specification and direction of E/I .	CUM	97.757 97.994	2004.96	196474
4	Total Amount				196474
	Add G.S.T. 12 %				23577
	Add 1 % Labor cess				1965
	Seigniorage Fee @1032.00/cum x0.10				10113
					232129

195999200

23520=00


1960=00

10089200

231568200


P.E.

Work Section Hayaghat

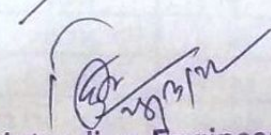

A.E.

Work Sub/Division
Hayaghat


E.E.

RWD Darbhanga -1

कार्यपालक अभियंता बौनीपुर के जाँच प्रतिवेदन के आधार पर
Technically sanctioned for Rs 231568=00 (Two Rupees Two
Lacs thirty one thousand five hundred Sixty eight) only.


Superintending Engineer
RWD, Works Circle, Darbhanga

4/5/22

Detailed Estimate for Temporary Restoration of Balia Brick bhattha to Navtoliya road for the year 2021 -22.

Block - Hayaghat

R.W.D.(W) Division -Darbhanga -1

Total Restoration Length ^{270.90 M} ~~272.00 M~~

Length -0.495 KM

S.N.	Item	No.	Length (M)	Width(M)	Depth (M)(AV)	Quantity (cum)
1	Providing and filling bricks bats in ditches including cost of bricks bats and labour all complete job as per specification and direction of E/I.					
	Chainage in M					
	At adjacent road	1	8.00 ✓	0.80 ✓	0.150 ✓	0.960
22		1	14.00 ✓	(2.50+2.60)/2	0.225 ✓	8.033
44		1	2.50 ✓	2.90 ✓	0.150 ✓	1.088
67		1	6.20 ✓	2.40 ✓	0.250 ✓	3.720
73		1	17.80 ✓	(1.40+0.90)/2	0.150 ✓	3.071
91		1	19.00 ✓	(2.30+2.50)/2	0.225 ✓	4.382
		1	4.00 ✓	0.80 ✓	0.100 ✓	0.320
125		1	9.00 ✓	0.80 ✓	0.150 ✓	1.080
		1	2.50 ✓	0.70 ✓	0.150 ✓	0.263
145		1	4.25 ✓	2.30 ✓	0.200 ✓	1.955
154		1	8.00 ✓	2.30 ✓	0.225 ✓	4.140
173		1	1.50 ✓	0.70 ✓	0.150 ✓	0.158
		1	1.10 ✓	0.70 ✓	0.100 ✓	0.077
		1	2.50 ✓	2.40 ✓	0.150 ✓	0.900
187		1	4.00 ✓	1.10 ✓	0.100 ✓	0.440
		1	5.10 ✓	0.90 ✓	0.100 ✓	0.459
		1	1.20 ✓	0.80 ✓	0.150 ✓	0.306
215		1	5.50 ✓	1.80 ✓	0.200 ✓	1.980
223		1	7.10 ✓	0.90 ✓	0.225 ✓	1.438
236		1	6.50 ✓	2.30 ✓	0.200 ✓	1.755
250		1	12.00 ✓	1.40 ✓	0.225 ✓	3.780
262		1	18.00 ✓	2.40 ✓	0.225 ✓	9.720
284		1	56.00 ✓	2.40 ✓	(0.150+0.250)/2	26.880
331 (Both side)		2	10.25 ✓	0.90 ✓	0.225 ✓	4.151
		1	8.10 ✓	2.40 ✓	0.225 ✓	4.374
Both side		2	3.80 ✓	0.75 ✓	0.225 ✓	1.283
353		1	6.00 ✓	2.40 ✓	0.225 ✓	3.240
359		1	5.70 ✓	0.80 ✓	0.150 ✓	0.684
Both side		2	20.00	0.80	0.200	6.400

Handwritten signature and date 07/11/21

Block - Hayaghat

Total Restoration Length - 272.00 M

R.W.D.(W) Division - Darbhanga -1

Length - 0.495 KM

S.N.	item	No.	Length (M)	Width(M)	Depth (M)(AV)	Quantity (cum)
	390	1	2.40	2.00	0.200	0.960
	Total Qty.		272.00			97.994

Total 97.994 m

JE
09/11/21

AE
07.11.21

EE
07.11.21

RWD(W) Division Darbhanga -1

checked by

AE

11.12.2021

JE

AE
11/12/2021

AE

AE
11.12.21

AE

Banipur