



Inspection Report For Flood Damage Work

1 Name of PIUs: Gopolgay - 2

2 Name of Block/Road: Bai/Kunthpun / PM OSY Kali Stlas To Baikunthpun

A For Road

Harijan Tola

1 Damage Location / Chainage:

1509 to 320m, 400 to 9103

2 Damage Length:

3 Nature of Damage:

Heavy Rain / Flood

4 Details of Restroration Works:

i. Material being used in Restoration Works:

Brick Bats

ii Equipments / Tools being used in Restoration Works: DCB, Treeder, Treeli, Released Rolles

iii Procedure taken up in Restoration Works: Yes

iv Restored Length:

3240

B For Bridge

x11x

1 Damage Location / Chainage:

2 Damage Length:

3 Nature of Damage:

4 Details of Restroration Works:

i. Material being used in Restoration Works:

ii Equipments / Tools being used in Restoration Works:

iii Procedure taken up in Restoration Works:

iv Restored Length:

Report

Name of Work

Motorable work of PMGSY Kali Sthan To

Baikunthpur Harijan Tola

Estimated Cost

.

3997500.00 3724600 200

Total length of Road

1.875 km

:- The present estimate has been farmed under the Description supervision of Assistant engineer in accordance with the order of Executive Engineer, RWD, WD Gopalganj-2, letter No. - 1574 dated 18-08-2020. The part of above mentioned road has been damaged due to heavy rain/flood. And due to this damage the transporation has been obstructed. The immediate motorable work is necessary in public interest. Villagers will be benefitted by the completion of this motorable work.

In the estimate there has been a provision of repairing the damaged part of the road & making it motorable by filling brickbats. In the context of post flood scenario there is still the flow of water which prevails through the damaged part of the road. Hence there has been a provision of laying 1 Nos of R.C.C. NP3 1000 MM Dia hume pipe.

In this estimate the rate of raw materials and labour wages has been prepared after the analysis of new rate. This estimate is as per the specifications. The estimate is devoted to technical and administrative acceptance.

Detailed Estimate For Motorable Work in Road fromPMGSY Kali Sthan To Baikunthpur Harijan Tola damaged due to Heavy rain/flood for year 2020-2021

šr.	Items	No.	L (M.)	W (M.)	D (M.)	Qty.	Unit	Rate	Amount
1	Providing brick bats billed in ditches including all cost of labour & material with all complete job.			5.820		922.20			
	CH - 150 M to 320 M	2	30.00	6.00	2.65	-954:00-	M3		
		1	24.00	6.00	2.90	417.60	МЗ		
		1	26.00	1.40	0.60	21.84	МЗ		
		1	30.00	1.10	0.80	26.40	М3		
		1	28.00	1.00	0.47	13.02	M3		
		1	-26.00	1.62	0.30	12.64	M3		
	CH - 700 M to 810 M	1	23.00	1.65	1.20	45.54	M3		
		1	4.00	1.30	0.85	4.42	M3		
		2	14.00	1.00	1.20 ·	, 33.60	M3		
		2	6.00	1.20 -	2.00	28.80	M3		
		1	8.00	2.00	0.50	8.00	M3		
		1	3.00	1.30	0.20	0.78	МЗ		
		1	11.00	1.05	0.30	3.47	M3		
		1	19.00	1.45	0.50	13.78	M3		
	-in	1	22.00	1.60	1.10	38.72	МЗ		
	Less for H.P.	0.79	1.23	1.23	40.60	0.72	МЗ	2412-11	36435405 366725
	California (California California			1		1621.88		2427.65	3937354.2 8
2	Providing & laying 1000 MM Dia NP3 Hume Pipe in single row -do-do- complete job.	2	2.50			1510:52 5.00	M	2744-50 4159:56	13723 \\ \(\frac{20797.80}{3687821.}
			1,000					3657263~	-3958152.08
	Add 1 % Contigency					HIPAR DECE		36573=	39581-52
	Yang 2 /v dalinga/					3693836=	تده	Total	3 72 4 6 3997733.60
		-			Carrie D.	36.938	e	Say	3997500.00

37,24,600c0

15.00.20 20


P19/9/20

Technically Approved for 18 39.9
Thousand five found only

(Rupes Thut philie pinety sen

Name of Road :- PMGSY Kali Sthan to Baikunthpur Harizan Tola



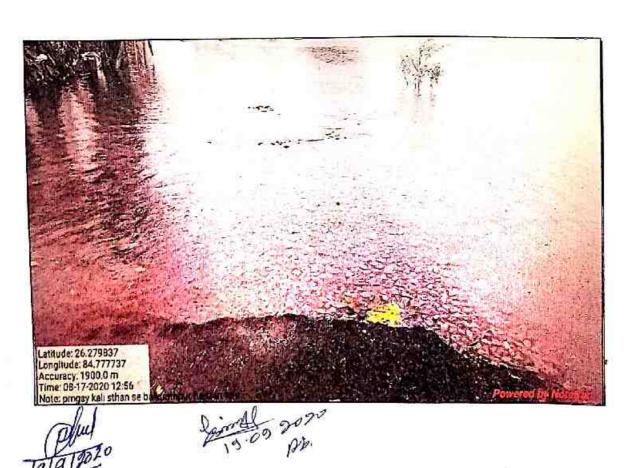

Name of Road :- PMGSY Kali Sthan to Baikunthpur Harizan Tola



