

PMGSY SC

M.B.No-3174

Schedule XLV-Form No. 134

पञ्जाब-पञ्जाब गुरुवा पञ्जाब-पञ्जाब गुरुवा पञ्जाब

पञ्जाब-पञ्जाब 2019-20

Ag.No.

DIVISION

पञ्जाब-पञ्जाब

पञ्जाब-पञ्जाब SUB-DIVISION

पञ्जाब

MEASUREMENT BOOK

M.B.No-3174

5th year Maintenance bill

72

Sch. XLV—Form No. 134

Particulars	Details of actual measurement				Contents of area
	No.	L.	B.	D.	
N/W — Chandra Tajpur Mukhyo path Se Mukund bahar Rabistom tak.					
Agency — Mathu Kumar					
Agreement NO — 22.580/19-20					
ADOC — 30/9/20					
① Restoration of rain cuts					3
$11 \times 6.76 \times 1.05 \times 0.300 = 23.42 \text{ M}^3$					
$13 \times 5.72 \times 1.15 \times 0.300 = 25.65 \text{ ''}$					
$15 \times 7.15 \times 1.0 \times 0.300 = 32.18 \text{ ''}$					
$9 \times 5.32 \times 1.15 \times 0.300 = 16.52 \text{ ''}$					
$5 \times 5.39 \times 1.15 \times 0.300 = 9.30 \text{ ''}$					
					107.07 M ³

② Making up shoulder.					
$11 \times 8.15 \times 1.10 = 98.44 \text{ M}^2$					
$7 \times 6.79 \times 1.10 = 52.86 \text{ ''}$					
$5 \times 2.16 \times 1.10 = 11.81 \text{ ''}$					
$10 \times 6.18 \times 1.10 = 67.8 \text{ ''}$					
$6 \times 7.10 \times 1.15 = 49.98 \text{ ''}$					
$8 \times 7.05 \times 1.05 = 59.22 \text{ ''}$					
$6 \times 8.50 \times 1.10 = 56.10 \text{ ''}$					
$7 \times 6.12 \times 1.15 = 49.22 \text{ ''}$					
					442.95 M ²
③ Repair of pothole filled with 75mm. w.b.m.					3
$25 \times 6.50 \times 1.25 \times 0.075 = 15.23 \text{ M}^3$					
$13 \times 6.10 \times 1.25 \times 0.075 = 7.43 \text{ ''}$					
					22.66 M ³

Continuation

Particulars	Details of actual measurement				Contents of
	No.	L.	B.	D.	
	17	5.59	1.25	0.075	8.90 M ³
	17	7.05	1.25	0.075	11.24 "
	13	7.50	1.25	0.075	9.140 "
	25	7.66	1.25	0.075	17.95 "
	15	7.69	1.25	0.075	10.81 "
	19	8.30	1.25	0.075	14.78 "
	27	8.59	1.25	0.075	21.74 "
	02	8.70	1.25	0.075	1.63 "
					118.82 M ³
					Ated qty 102.54 M ³

⑤ Patch repair over pot hole
with 20 mm fine carpet.
 $16 \times 5.13 \times 1.25 = 102.54 \text{ M}^2$

⑥ Patch repair over bitumen
surface

Qty same as per item

NO - ⑤ 102.54 M²

⑦ Maintenance of CD line
like Culvert. SNO

⑧ Maintenance of CD/Slab
culvert. 2 NO.

⑨ Maintenance of road
signs. 0.10 km.

⑩ Maintenance of 200 m &
km. slope. 0.20 km

⑪ Cutting of branches. 2 NO

⑫ Cutting of shrubs. 9 NO.

⑬ Fencing of parks 22 M²

Continuation

Continuation

1500 10-12-12

Abstract of cost

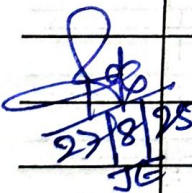
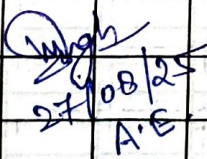
75

Sch. XLV—Form No. 134

Particulars	Details of actual measurement				Contents of area
	No.	L.	B.	D.	
① Restoration of rain cut					
RVTSP—(72) 107.02 M ³					
CR 565.25/M ³					R 59108.00
② Making up shoulder.					
RVTSP—(72) 442.95 M ²					
CR 54.16/M ²					R 23991.00
③ Repair of pot hole.					
RVTSP—(73) 102.54 M ³					
CR 387.03/M ³					R 39690.00
④ Patch repair over pothole					
RVTSP—(73) 102.54 M ²					
CR 310.54/M ²					R 31042.00
⑤ Patch repair over bulim surface					
RVTSP—(73) 102.54 M ²					
CR 320.60/M ²					R 33899.00
⑥ Maintenance of concrete pipe culvert. RVTSP—(73)					
5 NO CR 1131.64 each					R 5658.00
⑦ Maintenance of concrete culvert. RVTSP—(73) 2 NO					
CR 2336.81 each					R 4674.00
⑧ Maintenance of road sign					
RVTSP—(73) 0.100 km					
CR 1087.62/km					R 108.76
⑨ Maintenance of 200 M ² km. RVTSP—(73)					
0.200 km CR 54.33/km					R 10.87

Continuation

Sch. XLV—Form No. 134

Particulars	Details of actual measurement				Contents of area
	No.	L.	B.	D.	
⑩ cutting of branches.					
QNTD-⑩ 2 NO.					
CR 107.48 each					R 215.00
⑪ cutting of shrubs					
QNTD-⑪ 9 NO					
CR 6.60 each					R 59.00
⑫ Trimming of grass.					
QNTD-⑫ 27 M ²					
CR 2.20 / M ²					R 48.00
⑬ Road Marking					
QNTD-⑬ 235 M ²					
CR 942.80 / M ²					R 221579.00
⑭ White washing					
QNTD-⑭ 105 M ²					
CR 16.48 / M ²					R 1740.00
					R 402870.00
Less 0.55 % for bulrow					R 2216.00
					R 400654.00
					
27/8/25					
J.E.					
					
27/08/25					
A.E.					

Continuation