

प्रतिवेदन

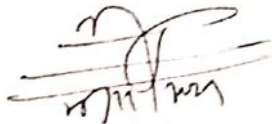
शीर्ष :- FDR Part 'A' (Temporary Restoration)

पथ का नाम :- Restoration of Road from Kurhani / Repair of road Lo30 to Sonearsa
Tada Muslim Tola. Under F.D.R.


प्रखंड:- कुदनी
प्राक्कलित राशि:- 11.633/ लाख
पथ की लम्बाई 1.36 KM

प्रस्तुत प्राक्कलन वर्ष 2021 में आई अति वृष्टि / बाढ़ के पानी का तीव्र प्रवाह के कारण पथ में काफी कटान / टूटान हो गया है। जिसके कारण आमजन को काफी कठिनाई के साथ-साथ आवागमन अवरुद्ध हो गया। विभागीय निर्देश के आलोक में प्रशासनिक विधि व्यवस्था एवं आवागमन प्रभावित नहीं होने देने के मद्देनजर क्षतिग्रस्त भाग में ब्रिक्स बट्स (ईट का टुकड़ा) से भराई कर उसके ऊपर रोड रोलर से COMPACTION का कार्य कराया गया है।

साथ ही प्राक्कलन में प्रयुक्त सामग्रियों वर्तमान अनुसूचित दर के आधार पर नये श्रम एवं सामग्री दर को प्रावधानित कर दर वि श्लेषण किया गया है। प्राक्कलन स्वीकृति हेतु समर्पित किया जाता है।
MIS FDR module में की गई ऑनलाइन प्रविष्टि की प्रति संलग्न है।



कनीय अभियंता
ग्रामीण कार्य विभाग
कार्य प्रशाखा कुदनी



सहायक अभियंता
ग्रामीण कार्य विभाग
कार्य अवर प्रमंडल कुदनी



कार्यपालक अभियंता
ग्रामीण कार्य विभाग
कार्य प्रमंडल मुजफ्फरपुर पूर्वी-1

Inspection Report for Flood Damage Work

Date

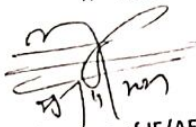
- 1 Name of PIUs :- EE, RWD (W) DIV - Muzaffarpur East -1
- 2 Name of Block/Road:- Kurhani / Repair of road from Lo30 to Sonearsa Tada Muslim Tola

A For Road


- 1 Damage Location/Chainage:- At many places.
- 2 Damage Length:- 0.123 km
- 3 Nature of Damage:- C/W, R/W Breached & embankment damaged.
- 4 Details of Restoration Works:- Brick Bats – 542.05 cum
 - i Material being used in Restoration Works:- Brick bats. Work is Satisfactory.
 - ii Equipments/Tools being used in Restoration Works:- Roller, tractor, tipper, trailer, jcb, manual tools.
 - iii Procedure Taken up in Restoration Works:- Breached portion is filled with Brick bats & embankment repaired for protected from further damaged due to flood water using Brick bats.
 - iv Restored Length:- 0.123 km

B For Bridge

- 1 Damage Location/Chainage
- 2 Damage Length
- 3 Nature of Damage
- 4 Details of Restoration Works
 - i Material being used in Restoration Works
 - ii Equipments/Tools being used in Restoration Works
 - iii Procedure Taken up in Restoration Works
 - iv Restored Length


Signature of JE/AE/EE

K. Ambekar
25/11/21


5-12-21


Signature
(Name of Inspector)



ग्रामीण कार्य विभाग

Rural Works Department, Govt of Bihar

DETAILED PROJECT REPORT FOR FDR

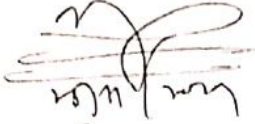



Name of the Road :-	Lo30 to Sonearsa Tada Muslim Tola		
DISTRICT	Muzaffarpur		
DIVISION	Muzaffarpur East-1		
BLOCK	Kurhani		
TOTAL LENGTH OF ROAD	:	1.360	KM
CONSTRUCTION COST	:	11.633	Lac


Submitted By :- Executive Engineer
RWD Work Division Muzaffarpur East-1

GENERAL ABSTRACT		
Name of the Road :-		Lo30 to Sonarsa Tada Muslim Tola
District	Muzaffarpur	
Block	Kurhani	
Division	Muzaffarpur East-1	
Length of Road (In Km)		1.36 KM
Sl. No.	DESCRIPTION	AMOUNT (LAKHS)
1	Brick Bat	11.633
2	Sand Filling	0.000
3	Sand bag	0.000
4	Bamboo Piles	0.000
GRAND SUB TOTAL		11.633
TOTAL COST OF PROJECT IN LACS =		11.633

Say Rs. 11.63 Lacs

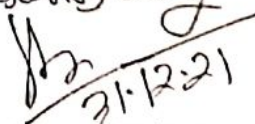


 JE
RWD


 AE
RWD


 EE
RWD

As Per S.E. RWD (W) Circle Muz.
 Letter No. 1179 Dated 01/10/2021
 Estimate has been verified by inspecting
 E. E. RWD. (W) Division Muzaffarpur

Technically Sanctioned for Rs. 11.63 Lacs
 (Rs. Eleven Lacs Sixty three thousand) only
 (provisionally)


 31.12.21
 Superintending Engineer
 Rural Works Department
 Work Circle: Muzaffarpur

 31.12.21

Name of the Road :- Lo30 to Soncarsa Tada Muslim Tola

Sl. No.	SDB SL NO	MORD Ref. No	Description	Unit	QUANTIT Y	RATE	AMOUNT (in Rs.)
1		13.7 SoR Bihar Govt. (1985)	Brick Bat <i>(Brick bats)</i> Labour for consolidation in Jhama metal by Road Roller in proper grade camber and super elevation dry and wet rolling including cost of running charge of roller diver and khalasi making and maintaining diversion light barrier - do - do - danger signal etc. Including cost of labour and Materials .all complete				
			Appendix - I	Cum	542.0		980743.58
2		11.20	Sand Filling Filling in foundation trenches as per drawing and technical specification Clause 305.3.9	Total	542.05	1809.49	-980825.64
			Appendix - II	Cum			
			Total	0.00	0.00		0.00
			Sub Total Cost				-980825.64
			GST 12%				117689.08
			LC 01%				9808.2698
			SF (101.47/cum)				55001.34
			Total Cost :-				1163334.32

1163453.79

[Signature]
Jie

[Signature]
K. Anubhai
25/11/24
P.E.

[Signature]
5.12.24

117689.23

97.44

55213.54