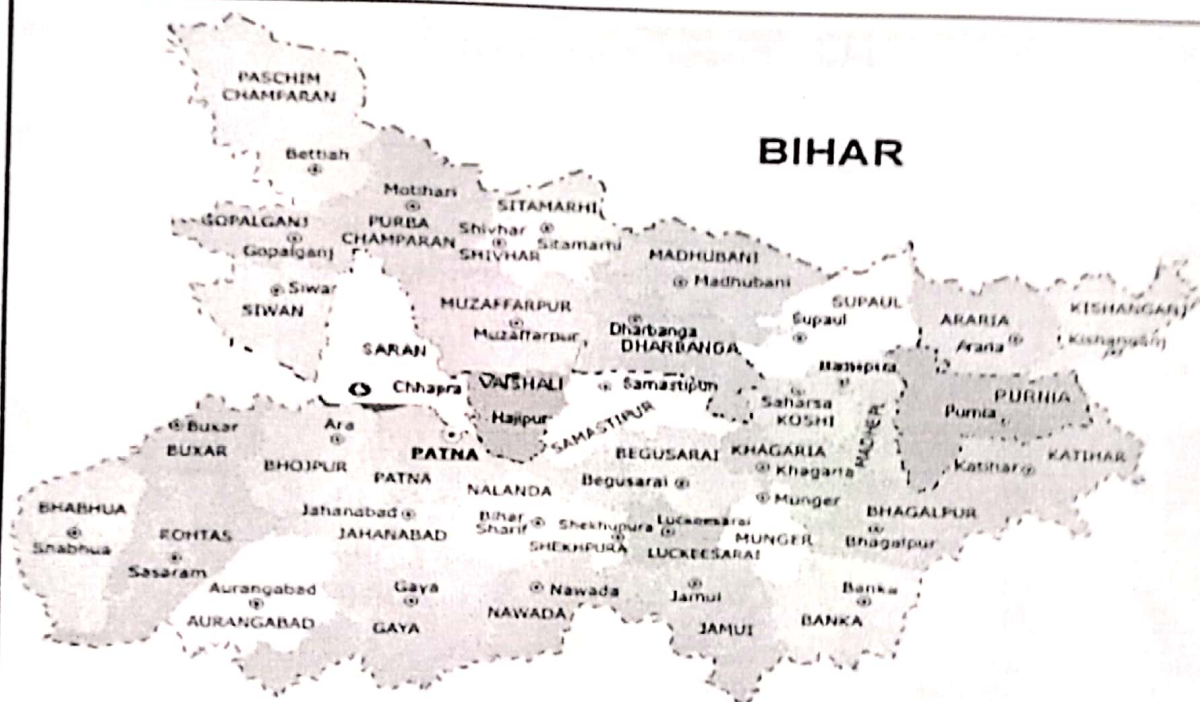




ग्रामीण कार्य विभाग

Rural Works Department, Govt of Bihar

DETAILED PROJECT REPORT FOR FDR



Name of the Road :- Takria Sarswa Gularia Soharwa To Thothi

DISTRICT Khagaria

DIVISION Gogri

BLOCK Chautham

CONSTRUCTION COST	:	6.127	Lac
-------------------	---	-------	-----

Submitted By :-
Executive Engineer
RWD Work Division Gogri

FDR

FORMAT P-5

YEAR (2020 - 2021)

GENERAL ABSTRACT OF COST


Block:- Chautham


DISTRICT- Khagaria

Name of Road:- Takria Sarswa Gularia Soharwa To Thothi

SL. No.	Item of Work	Gross Amount
A	TOTAL COST OF CONSTRUCTION	₹ 5.862 6.127 Lakhs
TOTAL COST OF PROJECT IN LAKHS =		₹ 5.862 6.127 Lakhs



Junior Engineer


Asstt. Engineer


Executive Engineer


E.E.
R.W.D. Saharsa

Technically approved for Rs 5,86,200 = ₹ (Rupees five lakh eighty six thousand two hundred only.)


Superintending Engineer
R.W.D. Works Circle
SAHARSA

Takria Sarswa Gularia Soharwa To Thothi

SL NO	Description	Unit	NOS	LENGTH	WIDTH	HEIGHT	QUANTITY	RATE	AMOUNT (in Rs.)
1	Construction of Embankment with material obtained from borrow pits with a lift upto 1.5 m, transporting to the site spreading, grading to required slope and compacting to meet requirement of Tables 300.1 and 300.2 with a <u>lead upto 1000 m & 100 m</u> as per Technical Specification Clause 301.5 . (Including Royalty & Labour Cess).								
	CH-2965 M To CH-3100 M	Cum	1.00	32.00	(4.5+9.00)/2	(4+2)/2	648.00		
					6.75 Avg	3.00 Avg			
					(5+8+6)/3	(5+3+2)/3			
		Cum	1.00	83.00	6.33 Avg	3.33 Avg	1,752.22	163.53	391920.46
	As Per Revised For 1000 m lead	Cum					2,400.22	173.11	415502.00
2	Sand bag-								
	Labour for Filling Sand Bag, Stitching and Placing etc. all complete as per specification and direction of E/I.								
	CH-650 At Hume Pipe Culvert Nos	Nos	37		Sand Bag				
	CH-2010 At Hume Pipe Culvert Nos	Nos	40		Sand Bag				
	CH-2110 At Hume Pipe Culvert Nos	Nos	105		Sand Bag				
	CH-2390 At Hume Pipe Culvert Nos	Nos	45		Sand Bag				
	CH-2675 At Hume Pipe Culvert Nos	Nos	70		Sand Bag				
			2,125.00		Sand Bag				
		Nos	2,422.00						
							2,422.00	24.71	59848.00
3	Bamboo Piles								
	Labour for cutting 62 mm to 75 mm dia bamboo piles to size and making shoes and driving etc. complete job as per specification and direction of E/I								
	50 mm to 75 mm dia M	M	155		10		1,550.00		
		M					1,550.00	43.16	66904.00
							TOTAL COST =		542232.00
							GST 12 % =		65067.84
							LABOUR CESS 1% =		5422.32
							TOTAL COST OF PROJECT =		612742.16

Junior Engineer

Assistant Engineer

Contributing Company

100

[illegible]

Continuation

Particulars	Details of actual measurement				Contents of area
	No.	L.	B.	D.	
<u>ABSTRACT OF WT</u>					
1) Labour filling sand bag					
checking and plaining					
cls — cls — 2c					
182.0 bag	—	TM 3P	—	(2)	
7790 bag	—	"	"	(2)	
750 bag	—	"	"	(3)	
700 bag	—	"	"	(4)	
9422 bag					

Continuation

Particulars	Details of actual measurement				Contents of area
	No.	L.	B.	D.	
① Limit of embankment with material obtained from borrow pits with 14 G.A. - also also - 25					
2400-227 ² - T.M.A.P. - ⑤					
② 173 = 11 / m ² - 415502 m					45422482
144 G.T. @ 12% 4					
L.C. @ 01% - ④ 70492200					46127402

14/11/20	10/11/20	10/11/20	10/11/20	10/11/20	10/11/20
10/11/20	10/11/20	10/11/20	10/11/20	10/11/20	10/11/20
10/11/20	10/11/20	10/11/20	10/11/20	10/11/20	10/11/20
10/11/20	10/11/20	10/11/20	10/11/20	10/11/20	10/11/20
10/11/20	10/11/20	10/11/20	10/11/20	10/11/20	10/11/20
10/11/20	10/11/20	10/11/20	10/11/20	10/11/20	10/11/20
10/11/20	10/11/20	10/11/20	10/11/20	10/11/20	10/11/20
10/11/20	10/11/20	10/11/20	10/11/20	10/11/20	10/11/20
10/11/20	10/11/20	10/11/20	10/11/20	10/11/20	10/11/20
10/11/20	10/11/20	10/11/20	10/11/20	10/11/20	10/11/20


Continuation

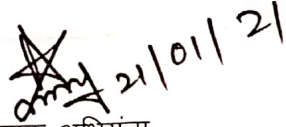
**कार्यपालक अभियंता का कार्यालय,
ग्रामीण कार्य विभाग, कार्य प्रमंडल, सहरसा।**

जाँच प्रतिवेदन

ग्रामीण कार्य विभाग, कार्य प्रमंडल, गोगरी अंतर्गत वर्ष 2020 के बाढ़ से क्षतिग्रस्त पथों को मोटरबुल करने के पश्चात् अधीक्षण अभियंता, ग्रामीण कार्य विभाग, कार्य अंचल, सहरसा के पत्रांक 1010 दिनांक 27.08.2020 के द्वारा दिये गये निदेश के आलोक में दिनांक 21.01.2021 को सहायक अभियंता, कनीय अभियंता के उपस्थिति में मोटरबुल पथ का स्थल निरीक्षण किया गया, जिसमें पथ में किये गये कार्यों को प्राक्कलन के अनुरूप पाया गया। कार्य वर्तमान स्थिति में संतोषप्रद है।

क्रमांक	पथ का नाम	क्षतिग्रस्त पथों की लम्बाई (मी० में)
1	2	3
1.	Shishwa ti Thuthi	64.30 M
2	Takria Sarswa Gularia Soharwa to Thothi	115.00 M
3	NH-31 (Thatha) to Nirpur	110.00 M
4	Rohiyar se Sonvarsha	92.00 M


कनीय अभियंता
ग्रामीण कार्य विभाग,
कार्य प्रशाख-चौथम।


सहायक अभियंता
ग्रामीण कार्य विभाग,
कार्य अवर प्रमंडल, चौथम।


कार्यपालक अभियंता,
ग्रामीण कार्य विभाग
कार्य प्रमंडल, सहरसा।