

Inspection Report For Flood Damage Work

Date :

1 Name of PIUs: Gopalganj - 2

2 Name of Block/Road: Baidanpur / SOGO To Khandaripur

A For Road

1 Damage Location / Chainage: 0m to 915m

2 Damage Length: 171m

3 Nature of Damage: Heavy Rain / Flood.

4 Details of Restoration Works:

i. Material being used in Restoration Works: Brick Mats

ii Equipments / Tools being used in Restoration Works: JCB, Tractor, Trolly, Belah, Roller, Shovel

iii Procedure taken up in Restoration Works: Yes

iv Restored Length: 171m

B For Bridge

N/A

1 Damage Location / Chainage:

2 Damage Length:

3 Nature of Damage:

4 Details of Restoration Works:

i. Material being used in Restoration Works:

ii Equipments / Tools being used in Restoration Works:

iii Procedure taken up in Restoration Works:

iv Restored Length:


JE
25/9/20
AE
25.09.2020
EE
25/9/20
Executive Engineer
(Name & Designation)
Hathua

Report

Name of Work :- Motorable work of S040 To Khumharipur

Estimated Cost :- 1498700.00

Total length of Road :- 0.915 km

Description :- The present estimate has been farmed under the supervision of Assistant engineer in accordance with the order of Executive Engineer, RWD, WD Gopalganj-2, letter No. - 1574 dated 18-08-2020. The part of above mentioned road has been damaged due to heavy rain/flood. And due to this damage the transporation has been obstructed. The immediate motorable work is necessary in public interest. Villagers will be benefitted by the completion of this motorable work.

In the estimate there has been a provision of repairing the damaged part of the road & making it motorable by filling brickbats. In the context of post flood scenario there is still the flow of water which prevails through the damaged part of the road. Hence there has been a provision of laying 1 Nos of R.C.C. NP3 1000 MM Dia hume pipe.

In this estimate the rate of raw materials and labour wages has been prepared after the analysis of new rate. This estimate is as per the specifications. The estimate is devoted to technical and administrative acceptance.

[Signature]
19/9/2020
J.E.

[Signature]
19.09.2020
A.E.

[Signature]
25/9/20
E.E.

Detailed Estimate For Motorable Work in Road from S040 To Khumharipur damaged due to Heavy rain/flood for year 2020-2021

Sr.	Items	No.	L (M.)	W (M.)	D (M.)	Qty.	Unit	Rate	Amount
1	Providing brick bats billed in ditches including all cost of labour & material with all complete job.								
	CH - 0 M to 915 M	1	12.00	1.30	0.60	9.36	M3		
		1	30.00	3.50	2.60	273.00	M3		
		1	12.00	5.00	0.80	48.00	M3		
		3	15.00	5.00	0.90	202.50	M3		
		1	9.00	1.00	0.95	8.55	M3		
		1	6.00	1.40	0.50	4.20	M3		
		1	15.00	1.50	0.90	20.25	M3		
		1	3.00	2.00	0.65	3.90	M3		
		1	5.00	1.00	1.00	5.00	M3		
		1	6.00	1.20	0.60	4.32	M3		
		1	12.00	2.00	0.60	14.40	M3		
		1	7.00	1.30	0.60	5.46	M3		
		1	9.00	1.05	0.55	5.20	M3		
	Less for H.P.	1.58	1.23	1.23	0.60	1.43	M3	2412.11	1453779.00
						602.70		2427.65	1463152.60
	Providing & laying 1000 MM Dia NP3 Hume Pipe in single row-do-do- complete job.	2	2.50			5.00	M	2744.50 4159.56	13723.00 20797.80
								146750.25	1483950.40
	Add 1 % Contingency							146750.25	14839.50
								Total	1482197.70
								Say	1498700.00

Say Rs 14,98,700/-
14.8226

[Signature]
19/9/2020
J.E.

[Signature]
19.09.2020
A.E.

[Signature]
25/9/20
E.E.


Technically Approved for Rs 14,987 Lacs (Rupees fourteen Lacs
Ninety Eight Thousand & Seven Hundred) only

Technically Approved for Rs 14,822 Lacs (Rupees fourteen Lacs
Eighty Two Thousand & Two Hundred) only.



अधीक्षण अभियंता

प्रति निवेदन ...

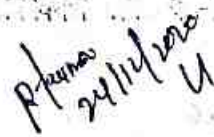

Name of Road :- S040 to Khumharipur



[Handwritten signature]
 14/9/2020
 H

[Handwritten signature]
 19-09-2020
 H.E.