Inspection Report For Flood Damage Work

1 Name of Plus: . (3 of algery) 2

2 Name of Block/Road: Brick Kundapus / Somwaligs Paschere Tolo Poismary School Sumwaleys Purvi Toly

For Road

1 Damage Location / Chainage: 50m 10 130m, 500m 加多30m, 1200m 加1280m

2 Damage Length:

3 Nature of Damage:

Heavy Rein / Flood.

4 Details of Restroration Works:

i. Material being used in Restoration Works: Brick Bats

ii Equipments / Tools being used in Restoration Works: ICA, Tracken, Prote, Belchy, Skaw.

iii Procedure taken up in Restoration Works: 423

iv Restored Length: 336 M

B For Bridge

MIA

- 1 Damage Location / Chainake
- 2 Damage Length.
- 3 Nature of Damage.
- 4 Details of Restroration Works:
 - . Material being used in Restoration Works
 - ii Equipments / Tools being used in Restoration Works:
 - iii Procedure taken up in Restoration Works:
 - iv Restored Length

Report

Name of Work

Motorable work of Sonwaliya Paschim Tola . Primary School To Sonwaliya Purvi Tola

Estimated Cost

,6508000.00-

60,92,000000

Total length of Road

2.200 km

:- The present estimate has been farmed under the Description supervision of Assistant engineer in accordance with the order of Executive Engineer, RWD, WD Gopalganj-2, letter No. - 1574 dated 18-08-2020. The part of above mentioned road has been damaged due to heavy rain/flood. And due to this damage the transporation has been obstructed. The immediate motorable work is necessary in public interest. Villagers will be benefitted by the completion of this motorable work.

In the estimate there has been a provision of repairing the damaged part of the road & making it motorable by filling brickbats. In the context of post flood scenario there is still the flow of water which prevails through the damaged part of the road. Hence there has been a provision of laying 2 Nos of R.C.C. NP3 1000 MM Dia hume pipe.

In this estimate the rate of raw materials and labour wages has been prepared after the analysis of new rate. This estimate is as per the specifications. The estimate is devoted to technical and administrative acceptance.

PDF Compressert Free Versi Motorable Work in Road from Sonwaliya Paschim Tola mary School damaged due to Heavy rain/flood for year 2020-2021


Items	No.	L (M.)	W (M.)	D (M.)	Qty.	Unit	Rate	Amount
Providing brick bats billed in ditches including all cost of labour & material with all complete job.								
CH - 50 M to 130 M	1	12.00	1.50	1.20	21.60	М3		13
	1	29.00	-1.60°	1.80	83.52	M3		
	1	30.00	1.40	1.10	46:20	M3		
CH - 500 M to 530 M	1	30.00	1.70	1.50	76.50	МЗ		
CH - 1200 M to 1280 M	1	11.00	1.50	1.30	21.45	МЗ		
	1	30.00	2.50	1.65	123.75	МЗ		
	1	29.00	1.45	1.20	50.46	МЗ		
	1	20.00	130	1.00	26.00	МЗ		
CH - 1800 M to 2080 M	2	30.00	-5:00	4.00	1200.00	МЗ		
	1	25.00	6.00	4.20	630.00	МЗ		
	2	30.00	2.00	3.00	360.00	МЗ		
Less for H.P.	1.58	1.23	1.23	0.95	2.27	M3	2.412-11	59527-9
					2637.21	МЗ	2427.65	<6402220:7
Providing & laying 1000 MM Dia NP3 Hume Pipe in single row -do-do- complete job.	4	2.50			246788 10.00	М	2744.50 4159.56 598.5243	5990173 41595:60 2子りない で31分刊
							~ i	° 6443816.3
Add 1 % Contigency							59802-	~-64438.16
				Rs.	6040045	سو	Total	6508254.5
							Say	6508200:0

Technically Approval for R 60.406 (Rupces Souty leve forty Thousand) only

PDF Compressor Free Version


ame of Road :- Sonwaliya Paschim Tola Primary School to Sonwaliya Purwi Tola




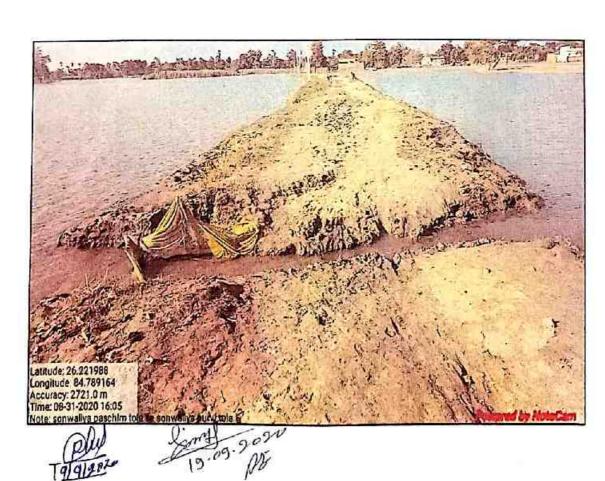

PDF Compressor Free Version


Name of Road :- Sonwaliya Paschim Tola Primary School to Sonwaliya Purwi Tola

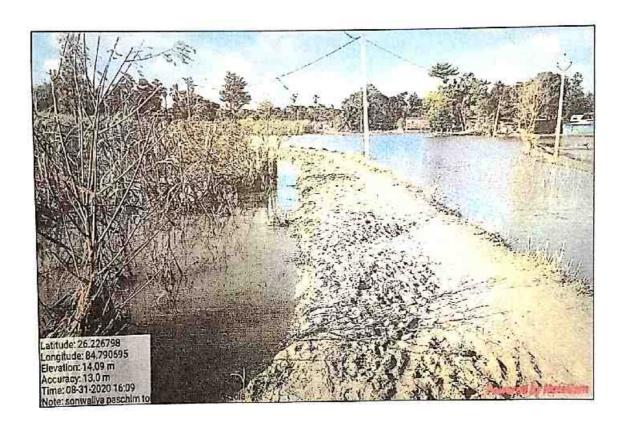

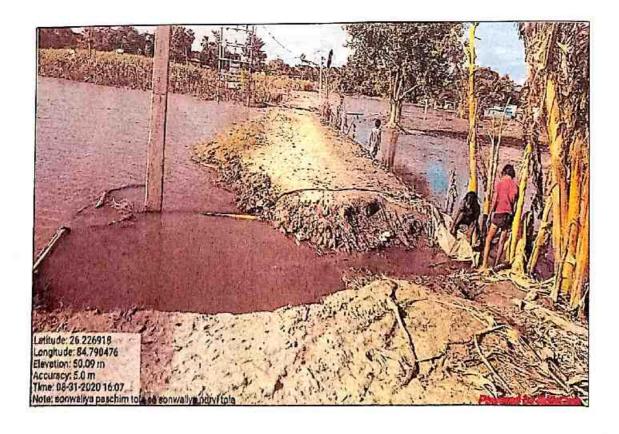

PDF Compressor Free Version

Primary School to Sonwaliya Purwi Tola

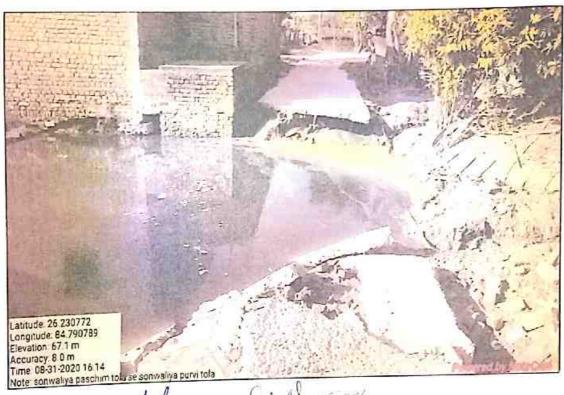

1919/2020

19.09 Aj