

57

(29)

## Inspection Report For Flood Damage Work

Date :

1 Name of PIUs : Gobalganj - 2

2 Name of Block/Road : Bailunthpur / Chakya Pm 657 Road to Khair's Ashg

### A For Road

1 Damage Location / Chainage : 500 m to 950 m

2 Damage Length : 325 m

3 Nature of Damage : Heavy Rain / Flood

### 4 Details of Restoration Works:

i. Material being used in Restoration Works : Brick Bats

ii Equipments / Tools being used in Restoration Works : JCB, Tractor, Puli, Belch, Shovel

iii Procedure taken up in Restoration Works : Yes

iv Restored Length : 325 m

### B For Bridge

N/A

1 Damage Location / Chainage:

2 Damage Length:

3 Nature of Damage:

### 4 Details of Restoration Works:

i. Material being used in Restoration Works :

ii Equipments / Tools being used in Restoration Works :

iii Procedure taken up in Restoration Works:

iv Restored Length :

phd  
25/12/20

25/12/20  
AE

25/12/20  
EE

Signature  
(Name of Inspector)

17/12/20



# ग्रामीण कार्य विभाग

Rural Works Department, Govt. of Bihar

## FLOOD DAMAGED REPAIR (F.D.R.)

STATE :- BIHAR  
DISTRICT :- GOPALGANJ  
BLOCK :- BAIKUNTHPUR

Chakiya PMGSY Road To Khaira Asha

ESTIMATED COST - RS.

~~1505900.00~~ Rs 14,61,00/-

SUBMITTED BY :-  
EXECUTIVE ENGINEER  
RWD (W) DIVISION  
GOPALGANJ-2

## Report

Name of Work :- Motorable work of Chakiya PMGSY Road To Khaira Asha

Estimated Cost :- ~~1505900.00~~ Rs 1416100.00

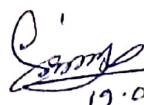
Total length of Road :- 1.550 km


Description :- The present estimate has been farmed under the supervision of Assistant engineer in accordance with the order of Executive Engineer, RWD, WD Gopalganj-2, letter No. - 1574 dated 18-08-2020. The part of above mentioned road has been damaged due to heavy rain/flood. And due to this damage the transporation has been obstructed. The immediate motorable work is necessary in public interest. Villagers will be benefitted by the completion of this motorable work.

In the estimate there has been a provision of repairing the damaged part of the road & making it motorable by filling brickbats. In the context of post flood scenario there is still the flow of water which prevails through the damaged part of the road.

In this estimate the rate of raw materials and labour wages has been prepared after the analysis of new rate. This estimate is as per the specifications. The estimate is devoted to technical and administrative acceptance.

  
19/9/2020  
J.E.

  
19.09.2020  
A.E.

  
19/9/20  
E.E.



Sr.	Items	No.	L (M.)	W (M.)	D (M.)	Qty.	Unit	Rate	Amount
1	Providing brick bats billed in ditches including all cost of labour & material with all complete job.								
	CH - 500 M to 950 M	1	4.00	1.35	0.35	1.89	M3		
		1	2.00	1.60	0.50	1.60	M3		
		1	5.00	1.80	0.80	7.20	M3		
		1	6.00	2.00	0.90	10.80	M3		
		1	18.00	1.54	1.20	33.26	M3		
		1	17.00	1.60	0.25	6.80	M3		
		1	15.00	1.35	0.65	13.16	M3		
		1	20.00	1.45	0.35	10.15	M3		
		1	26.00	1.50	1.45	56.55	M3		
		1	29.00	0.85	1.50	36.98	M3		
		1	30.00	1.90	2.60	148.20	M3		
		1	14.00	3.00	2.00	84.00	M3		
		1	18.00	3.25	1.40	81.90	M3		
		1	20.00	2.60	0.50	26.00	M3		
		1	<del>18.00</del> 26.00	<del>1.90</del> 2.55	0.60	<del>26.00</del> 39.78	M3		
		1	<del>20.00</del> 24.00	<del>1.20</del> 1.60	0.45	<del>10.80</del> 17.28	M3		
		1	<del>18.00</del> 23.00	<del>0.75</del> 1.30	0.85	<del>14.55</del> 25.42	M3		
		1	28.00	1.35	0.35	13.23	M3		
	Less for H.P.	0	1.23	1.23	0.95	0.00	M3	2412.11	1393/86.24
						-614.20	M3	-2427.65	-1491054.13
2	Providing & laying 1000 MM Dia NP3 Hume Pipe in single row -do-do- complete job.	0	2.50			517.58	M	2733.38	1402153.59
						0.00	M	-4159.56	0.00
								1393/86.24	1402153.59
	Add 1 % Contingency							1.	-1491054.13
								1393/86.24	-1491054.13
								Total	1505964.67
								Say	1505964.67

PS-416100=00  
140711720  
Bury ps 14.0716  
19/9/20  
E.E.

Work Circle  
P. 10/20/2011