

Inspection Report For Flood Damage Work

Date :

1 Name of PIUs : Gopalgarh - 2

2 Name of Block/Road : Bakuntapur / Bangar Panchayat Bhawar Pashy
Tormiyo Tal

A For Road

1 Damage Location / Chainage : 50 m to 190 m

2 Damage Length : 159 m

3 Nature of Damage : Heavy Rain / Flood

4 Details of Restoration Works:

i. Material being used in Restoration Works: Bricks, Bricks

ii Equipments / Tools being used in Restoration Works: JCB, Tractor, Trolly, Shovel, Belely

iii Procedure taken up in Restoration Works:

Yes

iv Restored Length: 159 m

B For Bridge

N/A

1 Damage Location / Chainage:

2 Damage Length:

3 Nature of Damage:

4 Details of Restoration Works:

i. Material being used in Restoration Works :

ii Equipments / Tools being used in Restoration Works :

iii Procedure taken up in Restoration Works:

iv Restored Length:

25/03/2020
AE28/03/2020
EE
Signature
(Name of Inspector)

20



ग्रामीण कार्य विभाग

Rural Works Department, Govt. of Bihar

FLOOD DAMAGED REPAIR (F.D.R.)

STATE :- BIHAR
DISTRICT :- GOPALGANJ
BLOCK :- BAIKUNTHPUR

Bangra Panchyat Bhawan PMGSY to Miya Tola

ESTIMATED COST - RS.

~~2515700.00~~ Rs 2388200.00

SUBMITTED BY :-
EXECUTIVE ENGINEER
RWD (W) DIVISION
GOPALGANJ-2

Report

Name of Work :- **Motorable work of Bangra Panchyat Bhawan
PMGSY to Miya Tola**

Estimated Cost :- ~~2515700.00~~ ~~Rs 2383 200 ±00~~

Total length of Road :- **1.480 km**


Description :- The present estimate has been farmed under the supervision of Assistant engineer in accordance with the order of Executive Engineer, RWD, WD Gopalganj-2, letter No. - 1574 dated 18-08-2020. The part of above mentioned road has been damaged due to heavy rain/flood. And due to this damage the transporation has been obstructed. The immediate motorable work is necessary in public interest. Villagers will be benefitted by the completion of this motorable work.

In the estimate there has been a provision of repairing the damaged part of the road & making it motorable by filling brickbats. In the context of post flood scenario there is still the flow of water which prevails through the damaged part of the road.

In this estimate the rate of raw materials and labour wages has been prepared after the analysis of new rate. This estimate is as per the specifications. The estimate is devoted to technical and administrative acceptance.


19/09/2020

J.E.

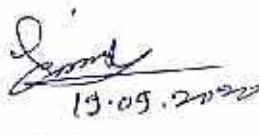
19.09.2020

A.E.


19/09/2020

E.E.

**Detailed Estimate For Motorable Work in Road from Bangra Panchyat Bhawan
PMGSY to Miya Tola damaged due to Heavy rain/flood for year 2020-2021**

Items	No.	L (M.)	W (M.)	D (M.)	Qty.	Unit	Rate	Amount
Providing brick bats filled in ditches including all cost of labour & material with all complete job.								
CH - 50 M to 130 M	1	22.00	3.00	0.60	39.60	M3		
	1	17.00	1.00	1.50	25.50	M3		
	1	14.00	4.00	1.00	56.00	M3		
	1	20.00	1.50	1.20	36.00	M3		
	1	2.00	1.50	0.80	2.40	M3		
	1	3.00	1.00	0.60	1.80	M3		
	1	5.00	1.40	0.45	3.15	M3		
	1	15.00	6.00	6.00	356.00	M3		
	1	17.00	6.00	6.00	612.00	M3		
	1	30.00	2.40	1.20	86.40	M3		
	1	15.00	2.50	4.00	150.00	M3		
	1	5.00	1.40	0.80	5.60	M3		
	1	9.00	0.70	1.20	7.56	M3		
Less for H.P.	0	1.23	1.23	0.95	0.00	M3	2412.11	294459.5
					-1026.01	M3	2427.65	2490793.18
2 Providing & laying 1000 MM Dia NP3 Hume Pipe in single row -do-do- complete job.	0	2.50			972.00	M	2732.55	2359700.00
					0.00		4159.56	0.00
								2359700.00
Add 1 % Contingency							234459.5	2490793.18
							23446.0	24907.93
								2388277.08
							Total	2515701.11
							Say	2515700.00

Rs 2515700.00


2368041.2

Say Rs 23.680.41



19/9/2020

J.E. Technically Approval for Rs 23.680.41 (Rupees Twenty Three Lakh & Sixty Eight Thousand Only)



19/9/2020

A.E.



19/9/2020

E.E.

13/10/21
Superintending Engineer
F.W.D Work Circle-Siwan
R.D. 11/10/21