

# Inspection Report for Flood Damage Works

25

v

0

56

7

Date

1. Name of P.W. Executive Engineer, R.W.D., Dhaka

2. Name of Block Chiraiya

Name of Road - Mishrauliya Pakariya R.E.D Path to Sundarban  
(A) For Road Dil Mohamad

Damage Location/Chainage :-

Damage Length : 20.0m

Nature of Damage:- Breach Water logging

Details of Restoration Works:-

(i) Material being used in Restoration works:- Brick/bals

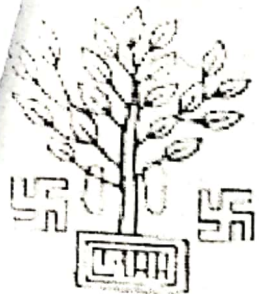
(ii) Equipments/ Tools being used in Restoration works:-

(iii) Procedure taken up in Restoration works:- Dependent

(iv) Restored Length 20.0m

Signature of Inspecting officer  
(Executive Engineer)

R.W.D., W.D.



# ग्रामीण कार्य विभाग

Rural Works Department, Govt of Bihar

**Head- FDR(2245)**

**YEAR 2020-21**

**Name of Division - R.W.D. (W) Division Dhaka**

**Block :- Chiraiya**

**District :- East Champaran**

**Name of Road - Estimate for Emergent Repair of Road breaches (Damaged by Flood ) for Mishrauliya Pakariya REO Path to Sunderpur Dil Mohamad**

**Length - 4.00 K.M**

**ESTIMATED COST :- 449300.00 Lakh**

**SUBMITTED BY:**

**EXECUTIVE ENGINEER,  
RWD WORKS DIVISION, DHAKA**



तकनीकी प्रतिवेदन

पथ का नाम :- मिथौलिया पकरीया R.E.O पथ से सुन्दरपुर दिल मोहम्मद पथ

प्रखंड का नाम :- चिरैया

शीर्ष :- PMGSY

प्राक्कलित राशि :- 4,49,300=00

अनुरक्षण अवधि :- अनुरक्षण अवधि के अंदर  
प्रस्तुत प्राक्कलन मिथौलिया पकरीया R.E.O पथ से सुन्दरपुर दिल मोहम्मद पथ में अतिवृष्टि / बाढ़ से क्षतिग्रस्त पथांशों यातायात पुर्नस्थापन हेतु तैयार किया गया है जिसकी प्राक्कलित राशि ... 4,49,300=00 है। प्रस्तुत प्राक्कलन सचिव, ग्रामीण कार्य विभाग, पटना के पत्रांक-2254 दिनांक-30.06.2020 के निर्देशानुसार तैयार किया गया है पथ में अतिवृष्टि/बाढ़ के कारण क्षतिग्रस्त पथांशों में Bridge built से भरने का प्रावधान किया गया है।

प्राक्कलन में दिये गये दर वर्तमान अनुसूचित दर के अनुरूप है।

22/12/2020

कनीय अभियंता,  
ग्रामीण कार्य विभाग,  
कार्य प्रशाखा चिरैया

22/12/2020

सहायक अभियंता,  
ग्रामीण कार्य विभाग,  
कार्य अवर प्रमंडल चिरैया

23/12/2020

कार्यपालक अभियंता,  
ग्रामीण कार्य विभाग,  
कार्य प्रमंडल, टाका

**of Work:- Estimate for Emergent Repair of Road breaches (Damaged by Flood ) for Mishrauliya Pakariya REO Path to Sunderpur Dil Mohamad Road**

I - 2245 Length-

Item No.	Name of Item	unit	No	Length	Width	Height	Qty.	Rate	Amount
	Labour for laying dry graded Jhama Khoa or stone filter under Brick Pitching or Boulder Pitching in slope or apron including light ramming etc. all complete as per approved design, specification and direction of E/I.	cum	As Per	Appendix 1			<del>130</del> 120	2147.41	<del>2,79,163.00</del> 2,57,689 = 20
	Providing and Laying reinforced cement concrete pipe NP3 for culverts on first class bedding of granular material in single row including fixing collar with cement mortar 1:2 but excluding excavation. Protection Works, backfilling, concrete and masonry	M	0	2.50M	0	0	0	4744.43	0.00
	Sand filling with Approved Materials seposited at site from roadway cutting and excavation from drain and foundation of other strecture graded and compected as per Technical Specification	M3	0				424.66	400.59	1,70,115.00

TOTAL (in Re.) ~~4,49,278.00~~

Total Rs- ~~4,49,300.00~~

4,27,800 = 20

4,27,800 = 20

*[Signature]*  
22/12/2020  
Junior Engineer,

Rural Works Department,  
Works Section, Dhaka

Chiraiya

*[Signature]*  
22/12/2020  
Assistant Engineer,

Rural Works Department,  
Works Sub Division, Dhaka

Chiraiya

*[Signature]*  
23/12/2020  
Executive Engineer,  
Rural Works Department,  
Works Division, Dhaka

Post Facto T.A./TS is accorded for Rs. 4,27,800 = 20

(.....crore.....Four.....lacs.....Twenty Seven.....thousand

.....Eight hundred.....) only.

S.E. (R.W.D.)  
works Circle  
Motihari

*[Signature]*  
26-3-21




me of Work:-


Estimate for Emergent Repair of Road breaches (Damaged by Flood ) for Mishrauliya  
Pakariya REO Path to Sunderpur Dil Mohamad Road


Appendix - I

Measurement for surfacing the Breach with Brick Bats

Chainage Km	Length (M)	Avg. Width In Meter	Avg. Depth In Meter	Quantity (Cum)
2.100	20.000	$\frac{3.50+6.50}{2}$	<del>-1.30</del> 1.20	<del>-130.00</del> 120
Total				<del>-130.00</del> 120

  
22/12/2020  
Junior Engineer  
Rural Works Department,  
Works Section, Dhaka  
Chiraiya

  
22/12/2020  
Assistant Engineer  
Rural Works Department,  
Works Sub Division, Dhaka  
Chiraiya

  
23/12/2020  
Executive Engineer,  
Rural Works Department,  
Works Division, Dhaka


ne of Work:-


Estimate for Emergent Repair of Road breaches (Damaged by Flood ) for Mishrauliya  
Pakariya REO Path to Sunderpur Dil Mohamad Road


Appendix - I

Measurement for surfacing the Breach with Sand Filling

Chainage Km	Length (M)	Avg. Width In Meter	Avg. Depth In Meter	Quantity (Cum)
2.100	20.000	$\frac{6.50+10.50}{2}$	2.498	424.66
Total				424.66

  
22/12/2020  
Junior Engineer  
Rural Works Department,  
Works Section, Chiraiya

  
22/12/2020  
Asistant Engineer  
Rural Works Department,  
Works Sub Division, Chiraiya

  
23/12/2020  
Executive Engineer  
Rural Works Department,  
Works Division, Dhaka