

F. D. R. - 2020-2021

MIB No. 1410

Schedule XLV-Form No. 134

સોજીતી કાગળ — ૧૦૫ દિવસથી ૪૨ સ
પાંચમી સંદેશ વિભાગ **DIVISION**
 ૧૭ ૪૨ ને મોકલવા ગયું.

DIVISION

SUB-DIVISION

Measurement Book

પ્રકાશિત થિયોગ્રાફિકલ મેપ 36
 માપકોષ 36 માં 36 (4-1/4)
 મશીન દે પ્રવેશિત થયેલ છે 36
 36 માપકોષ 36 માં 36 (4-1/4)
 36 માપકોષ 36 માં 36 (4-1/4)
 36 માપકોષ 36 માં 36 (4-1/4)

16/9
 Executive Engineer
 BWD Works Division

16/9
 16/9

Sch. XLV-Form No. 134

_____ DIVISION

_____ SUB-DIVISION

Measurement Book

No. 1410

Name of Officer _____

1.

Name of work -

Situation of work -

Agency by which work is executed -

Date of measurement -

No. and date of agreement.

(These four lines should be repeated at the commencement of the measurements relating to each work).

Particulars	Details of actual measurement				Contents of area
	No.	L.	B.	D.	
Name of work:	— Restoration of road				
	from TO 4 Harigan Tola to				
	Chardham Mandir Koshi				
	Bandh. (FDR-2020-21).				
Agency:	— Departmental				
Authority:	— E.E. RWD, Works Division,				
	Supaul.				
Date of Measurement:	— 01.09.2020				
1/2. Laying Brick Bat in					

Damage portion.

Ch. 6 m.

$$1 \times 6 \text{ m} \times 3.0 \text{ m} \times 0.300 \text{ m} = 5.400 \text{ m}^3$$

Ch. 52 m

$$1 \times 7 \text{ m} \times 1.5 \text{ m} \times 0.200 \text{ m} = 2.100 \text{ m}^3$$

Ch. 67 m

$$1 \times 6 \text{ m} \times 2.0 \text{ m} \times 0.150 \text{ m} = 1.800 \text{ m}^3$$

Ch. 78 m

$$1 \times 5 \text{ m} \times 3.0 \text{ m} \times 0.150 \text{ m} = 2.250 \text{ m}^3$$

Ch. 98 m

$$1 \times 2 \text{ m} \times 3.0 \text{ m} \times 0.150 \text{ m} = 0.900 \text{ m}^3$$

$$1 \times 2 \text{ m} \times 3.0 \text{ m} \times 0.150 \text{ m} = 0.900 \text{ m}^3$$

Ch. 138 m

$$1 \times 8 \text{ m} \times 1.0 \text{ m} \times 0.300 \text{ m} = 2.400 \text{ m}^3$$

Continuation

2/3. Labour for cutting 62					
mm to 75 mm dia Bamboo					

Ch. 300m			
	27 Nos. X	1.25m =	33.750m

Ch. 300 m

$$3 \text{ Nos.} \times 16 \text{ m} = 48.00 \text{ m}$$

Sch. XLV-Form No. 134

Particulars	Details of actual measurement				Contents of area
	No.	L.	B.	D.	
4/6. Supply of Bamboo at site.					
$\left(\frac{33.75}{1.25} \times 3.0 \right) m$					
$\left(\frac{\text{Bamboo Palleting} \times 3.0}{1.25} \right) + \text{Length of Runner (m)}$					
$+ \text{Area of Chachary m}$					
$= \left(\frac{33.75}{1.25} \times 3.0 \right) m \times 48 m + \frac{0}{1.413}$					
$= 81 m + 48 m + 0$					
$= 129 m$					
∴ Nos. of Bamboo				$= \frac{129}{6} = 21.50$	
				∴ 22 Nos.	
5/7. Labour. Filling empty cement					

bags with local sand,
stitching the bags and
placing including supply
of Sutli and Ec Bag.
etc. with all complete job.

Total nos. of Bag = 332 nos.

Total (in % Nos) = 3.32.

01.09.2020

J.E/Normali

10/09/20

21/9

21/9

Continuation

Inspection Report for Flood Damage Work

Date :

1. Name of PUs :- E.E. RWD, Works Division Supaul.

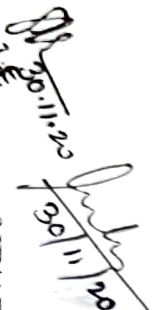
2. Name of Block/Road :- Nirmali/Toy Harigan Tla, to Charkham
Mandir Kosi Banch.

A. For Road

1. Damage Location/Chainage : 6 m, 52 m, 67 m, 78 m, 98 m, 138 m, 153 m, 154 m, 300 m.
2. Damage Length : 220 m
3. Nature of Damage : Due to flood
4. Details of Restoration Works :
 - i. Material being used in Restoration work : Bamboo, EcB filling with local sand, Brick bats
 - ii. Equipments/Tools being used in Restoration work : TCB, Tractor, Roller
 - iii. Procedure taken up in Restoration work : Filling
 - iv. Restored Length : 220 m

B. For Bridge

5. Damage Location/Chainage :
6. Damage Length : N/A
7. Nature of Damage :
8. Details of Restoration Works :
 - i. Material being used in Restoration work :
 - ii. Equipments/Tools being used in Restoration work :
 - iii. Procedure taken up in Restoration work :
 - iv. Restored Length :


Signature of JE/AE/EE


Signature
(Name of Inspector)
Work Division, Supaul