

RURAL WORKS DEPARTMENT



GOVERNMENT OF BIHAR

CIRCLE – R.W.D. works Circle, Kishanganj

DIVISION – R.W.D. works Division , Kishanganj-1

Name of Work - Restoration of road from T04 to Rampur

Block - Bahadurganj

Estimated cost - Rs 1571918.00

Year : 2020-21

TECHNICAL REPORT

Name of Work – FDR To Road From.....To 4 to Road No.

Head – FDR

Estimated cost –15.719..... Lacs

The work done estimate has been framed for the restoration (motorable) of traffic for the above road which was damaged during the year 2020-2021 flash flood.

(A) Source of materials

Brick Bats – Local Kiln

Fine sand – Local

Cement Bag – Local Market

Aggregate for G.S.B – Matigara (Siliguri) by road up to site.

Bamboo – Local

Earth – Private land from 1000m lead.

(B) Rate - Carriage has been analyzed on minimum lead. Finished rate has been calculated without contractor's profit on MORD norms. Carriage of materials has been added to finished rate. Basic Rates are evaluated from rates approved by State schedule rate committee. 12% GST & 1% Labour cess has been added in the estimate in abstract part.

Sanction of estimate is much needed for payment of the work which was already done.


09.12.20

J.E
R.W.D
Kishanganj-1


09/12/2020

A.E
R.W.D
Kishanganj-1


13/12/2020

E.E
R.W.D
Kishanganj-1

Date:

Inspection Report for flood damage work

1. Name of PIUs- RW0, Keishamseemj-1.

2. Name of Block/Road- To 4 to Raampur under Behedusam Block.

A. For Road

1. Damage Location/Chainage :

2. Damage Length :

3. Nature of Damage :

4. Details of Restoration :

i Material being used in Restoration

: Bamboo, sand bags, Bricks

ii Equipment/Tools being used in Restoration works: Tractor

bags.

iii Procedure taken up in Restoration works

: manual.

iv Restored Length

: 175.00 m.

B. For Bridge

1. Damage Location/Chainage :

2. Damage Length :

3. Nature of Damage :

4. Details of Restoration :

i Material being used in Restoration

:

ii Equipment/Tools being used in Restoration works:

:

iii Procedure taken up in Restoration works

:

iv Restored Length

:

Signature of JE/AE/EE

R
13/12/2020
AE

C
13/12/2020

Signature

(Name of Inspector)

कार्यपालक अधिकारी
आमीण कार्य विभाग
कार्य प्रमाणल, अररिया

Detailed Estimate

Name of work :-

Restoration of road from T04 to Rampur

Sl No	Item	No	Length	Width	Height	Qty	Unit	Rate	Amount			
1	Providing and cutting of 62 mm to 75 mm dia bamboo piles to size and making shoes, all complete job ----E/I	52	3.50	-	-	180.83	RM	50.20	23385.00			
		95	3.00	-	-	285.00						
Total						465.83	RM	50.20	23385.00			
2	Providing, fitting and fixing 62 mm to 75 mm dia bamboo runners in position at every vertical pile with 150 mm long nails or 38 swg G.I. wire including cost of G.I. wire or nails complete job as per specification and direction of E/I.	4	31.00	-	-	124.00	RM	28.53	10385.00			
		4	60.00	-	-	240.00						
Total						364.00	RM	28.53	10385.00			
3	Providing and filling empty cement bags with local sand, stitching the bags and placing including supply of sutli etc. all complete job ----E/I	1	30.00	2.00	1.50	90.00	Cum	38.14	810971.00			
		1	40.00	2.00	1.50	120.00						
Total						225.00						
Total						175.00						
Total						112.50						
Total						722.50	Cum	38.14	810971.00			
Total						= 25515.09 cft	Say					
Total						21263.00	Nos	38.14	810971.00			
Total						Total:-						
Total						Rs 1391078.00		Rs 166929.00	Rs 13911.00			
Total						Add GST @ 12 % :-						
Total						Add LC @ 01 % :-						
Total						Total cost of Restoration with GST & LC:-		Rs 1571918.00	Say RS - 1571900/-			


09/12/2020
J.E
RWD
Bahadurganj

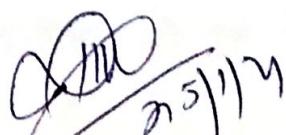

09/12/2020
A.E
R.W.D
Bahadurganj


13/12/2020
E.E
R.W.D
Kishanganj - I

Technically approved for Rs 1571900/-

(Rs Fifteen Lacs, ^{one} Seventy ¹¹ thousand and nine

hundred only


25/12/2020

अधीक्षण अभियन्ता
ग्रामीण कार्य विभाग
कार्य अंचल, किशनगंज