

71

Inspection Report For Flood Damage Work

Date :

1 Name of PIUs : Chebanganj - 22 Name of Block/Road : Baikunthapur / Balapal To Sonwaliga via Digha Talg**A For Road**1 Damage Location / Chainage : 200 m to 225 m , 400 m to 700 m2 Damage Length : 219 m3 Nature of Damage : Heavy Rain / Flood

4 Details of Restoration Works:

i. Material being used in Restoration Works : Brick Ballii Equipments / Tools being used in Restoration Works : JCB, Tractor, Trali, Boleha, Shoveliii Procedure taken up in Restoration Works : Yesiv Restored Length : 219 m**B For Bridge**N/A

1 Damage Location / Chainage:

2 Damage Length:

3 Nature of Damage:

4 Details of Restoration Works:

i. Material being used in Restoration Works :

ii Equipments / Tools being used in Restoration Works :

iii Procedure taken up in Restoration Works:

iv Restored Length :

[Signature]
 25/9/20

[Signature]
 25/9/20
 AE

[Signature]
 25/9/20
 EE

[Signature]
 25/9/20
 Executive Engineer
 (Name of PWD)
 Hathua



ग्रामीण कार्य विभाग

Rural Works Department, Govt. of Bihar

FLOOD DAMAGED REPAIR (F.D.R.)

STATE :- BIHAR
DISTRICT :- GOPALGANJ
BLOCK :- BAIKUNTHPUR

Bala Pul To Sonwaliya Via Digha Tola

ESTIMATED COST - RS.

~~2016000.00~~

Rs 1909700.00
/ /

**SUBMITTED BY :-
EXECUTIVE ENGINEER
RWD (W) DIVISION
GOPALGANJ-2**

Report

Name of Work

:- Motorable work of Bala Pul To Sonwaliya Via
Digha Tola

Estimated Cost

:- -2016000.00- Rs 1909700.00

Total length of Road

:- 1.175 km


Description

:- The present estimate has been farmed under the supervision of Assistant engineer in accordance with the order of Executive Engineer, RWD, WD Gopalganj-2, letter No. - 1574 dated 18-08-2020. The part of above mentioned road has been damaged due to heavy rain/flood. And due to this damage the transporation has been obstructed. The immediate motorable work is necessary in public interest. Villagers will be benefitted by the completion of this motorable work.

In the estimate there has been a provision of repairing the damaged part of the road & making it motorable by filling brickbats. In the context of post flood scenario there is still the flow of water which prevails through the damaged part of the road.

In this estimate the rate of raw materials and labour wages has been prepared after the analysis of new rate. This estimate is as per the specifications. The estimate is devoted to technical and administrative acceptance.


14/9/2020
J.E.


19/09/2020
A.E.


19/9/20
E.E.

Detailed Estimate For Motorable Work in Road from Bala Pul To Sonwalia Via Digha Tola damaged due to Heavy rain/flood for year 2020-2021

Sr.	Items	No.	L (M.)	W (M.)	D (M.)	Qty.	Unit	Rate	Amount
1	Providing brick bats billed in ditches including all cost of labour & material with all complete job.								
	CH - 200 M to 225 M	1	4.00	4.20 5.00	0.80	13.44 16.00	M3		
		1	14.00 15.00	0.35 1.00	1.20	12.28 18.00	M3		
		1	10.00	1.00	1.10	11.00	M3		
	CH - 400 M to 700 M	1	23.50 25.00	0.90 1.00	0.95	20.07 23.75	M3		
		1	30.00	1.00	1.00	30.00	M3		
		1	24.00	1.40	1.50	50.40	M3		
		1	30.00	3.50	1.50	157.50	M3		
		1	30.00	3.20 4.00	1.40	130.40 168.00	M3		
		1	16.00	4.00	1.00	64.00	M3		
		1	25.00	2.50	1.30	81.25	M3		
		1	10.00	3.00	1.50	45.00	M3		
	Less for H.P.	0	1.23	1.23	5.00	0.00	M3	2412-11	1498789-1890805.55
						-822.40 621.36	M3	2427.65	1996499.36
2	Providing & laying 1000 MM Dia NP3 Hume Pipe in single row -do-do- complete job.	0	2.50			0.00	M	2744.80 4159.56	0.00 1498789-1890805.55
								1498789	1996499.36
	Add 1 % Contingency							14988	1890805.06
									19964.99
									1909713.60
								Total	2016464.35
								Say	1909713.60
									2016000.00

Rs 2016000.00

+909700.00

Rs 1513777.00


Say Rs 15.138 Lacs

[Signature]
19/9/2020
J.E.

[Signature]
19.09.2020
A.E.

[Signature]
19/9/20
E.E.

Technically Approved For Rs 15.138 lac. (Rupees fifteen
lac Thirteen Thousand & Eight Hundred) only

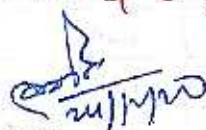

Superintending Engineer
R.W.D. Work, Circle-Siwan

P/Secy
24/11/2020
4