




ग्रामीण कार्य विभाग

2021-2022

FLOOD DAMAGED REPORT

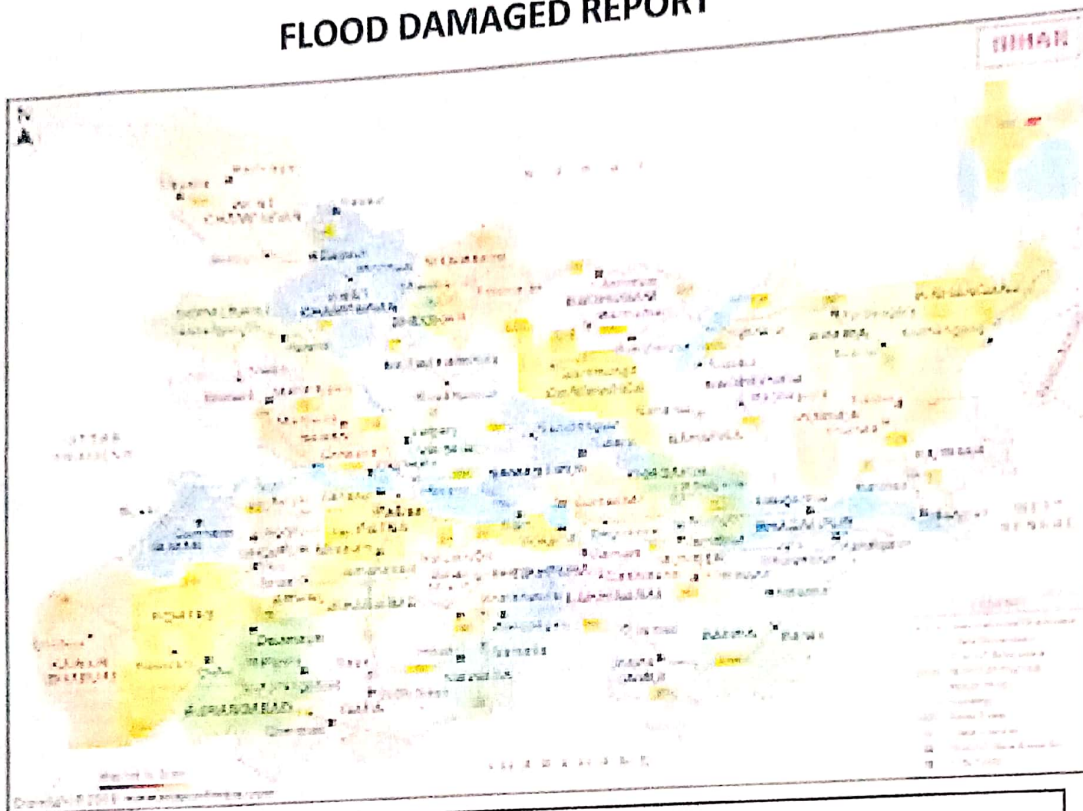

MOTORABLE OF PMGSY ROAD TO BANDHOLI BIN TOLA

DISTRICT :- GOPALGANJ

DIVISION :- GOPALGANJ -2

BLOCK :- BAIKUNTHPUR

TOTAL LENGTH OF THE ROAD : 1.039 KM

DAMAGED LENGTH OF ROAD : 0.079 KM

PART -A TOTAL COST OF INTIAL RECTIFICATION IN : 1.71 Lacs

TOTAL SEIGNIORAGE FEE : 0.003 Lacs

TOTAL COST OF PROJECT : 1.711 Lacs

SUBMITTED By: EXECUTIVE ENGINEER
RWD (W) DIVISION GOPALGANJ-2

Name of work :-

MOTORABLE OF PMGSY ROAD TO BANDHOLI BIN TOLA

Estimate Cost -

1.711 Lakhs

Total Length :-

1.039 Km

Description :- The Present estimate has been farmed under the supervision of Assistant Engineer in accordance with the order of Executive Engineer , RWD, Gopalganj 2. The part of above mentioned road has been damaged due to heavy rain/flood. And due to this damage the transportation has been obstructed. The immediate motorable work is necessary in public interest. Village will be benefitted by the completion of this motorable work.

In the estimate has been provision of repairing the damaged part of the road & making it motorable by filling brickbats. In the context of post flood scenario there is still the flow of water which prevails through the damaged part of the road.

In this estimate the rate of raw materials and labour wages has been prepared after the analysis of new rate. This estimate is as per specification . The estimate is devoted to technical and administrative acceptance.

Plw
5/3/22

J.E

A.E

Plw
5/3/22

E.E

Inspection Report For Flood Damage Work

Date:

1 Name of PWS:

E.E. RWD Copacig - 2

2 Name of Block/Road: Reithatt / Pmhy Road Bandhwa blorhly
Teh

A For Road

1 Damage Location / Chainage:

2 Damage Length: 75 m

3 Nature of Damage: Flood / heavy rain

4 Details of Restoration Works:

i. Material being used in Restoration Works: Bit 45 mts

ii Equipments / Tools being used in Restoration Works: 5' x 2 Trench

iii Procedure taken up in Restoration Works:

iv Restored Length: 75

B For Bridge

1 Damage Location / Chainage:

2 Damage Length: 75 m

3 Nature of Damage:

4 Details of Restoration Works:

i. Material being used in Restoration Works:

ii Equipments / Tools being used in Restoration Works:

iii Procedure taken up in Restoration Works:

iv Restored Length:

Phu
5/3/22

JE

AE

M
5/3/22

EE

M
28/3/22
R2

Inspecting
Officer

FLOOD DAMAGED REPORT

GENERAL ABSTRACT OF COST

MOTORABLE OF PMGSY ROAD TO BANDHOLI BIN TOLA

NAME OF ROAD :-
DISTRICT :- GOPALGANJ
BLOCK :- BAIKUNTHPUR
DIVISION :- GOPALGANJ -2
TOTAL LENGTH OF THE :- 1.039 KM
DAMAGED LENGTH OF :- 0.079 KM

SL.No	Item of Work	AMOUNT
A	INITIAL RECTIFICATION INCLUDING SURFACE RENEWAL	1.71
B	Total Seigniorage Fee	0.003
	TOTAL	1.711

Phul
5/3/22

Junior Engineer

ASSTT. Engineer

On
5/3/22

Executive Engineer

F.D.R. Technically Sanctioned for Rs 1.717 Lacs (Rupees One Lac Seventy one Thousand & one Hundred) only

On
22/04/22

Superintending Engineer
R.W.D. Work, Circle, Siwan

Phul
22/04/22

GENERAL ABSTRACT OF COST FOR MAINTENANCE OF ROAD

MOTORABLE OF PMGSY ROAD TO BANDHOLI BIN TOLA

NAME OF ROAD :-	:-	GOPALGANJ
DISTRICT	:-	BAIKUNTHPUR
BLOCK	:-	GOPALGANJ -2
DIVISION	:-	1.039 KM
TOTAL LENGTH OF THE ROAD	:-	0.079 KM
DAMAGED LENGTH OF ROAD	:-	

SL.No	DESCRIPTION	AMOUNT	1 % Labour Cess	12 % GST	1 % Labour Cess & 12 % GST AMOUNT (LAKHS)
	INITIAL RECTIFICATION INCLUDING SURFACE RENEWAL				
		1.51	0.015	0.181	1.71
1	BRICK BATS				1.71
	SUB TOTAL	1.51	0.015	0.181	
	Total Seigniorage Fee				0.003
	TOTAL COST OF PROJECT IN LAKHS	1.51	0.015	0.181	1.711

Plu
5/3/22

Junior Engineer

Asstt. Engineer

5/3/22

Executive Engineer

SBD	MORD	Description	Unit	Nos	Length	Width	Height	Quantity	Rate	Amount
SL.No	Ref No									
1		construction of subgrade and Earthen shoulders with approved material obtained from borrow pits with all lifts and lead , transporting to size , spreading , grading to required slope and compacted to meet requirement of Table 300.2 with lead upto 1000 m as Technical specification clause 303.1.								
		Ch	400	422	Cum	1	22	2.5	1.2	66.00
		Ch	400	408	Cum	1	8	4	1.3	41.60
		Ch	410	411	Cum	1	1	1	0.1	0.10
		Ch	415	416	Cum	1	1	1.5	0.2	0.30
		Ch	650	670	Cum	1	20	3.5	1.25	87.50
2	301	Providing Brick bats including spreading laying hand packing and compacting with C.I Hammer in layers not exceeding 75 mm thick including cost of light barriers , danger signals, chowkidar,taxes , royalty etc all complete job as per specification and direction of E/I including carriage cost of bricks.							244.2	47741
		Ch	400	422	Cum	1	20	2.75	0.25	13.75
		Ch	400	410	Cum	1	10	3.785	0.25	9.46
		Ch	410	440	Cum	1	30	3.75	0.25	28.13
		Ch	500	511	Cum	1	11	1.5	0.3	4.95
		Ch	650	670	Cum	1	8	1	0.3	2.40
									58.69	103407
									TOTAL COST OF PAVEMENT IN RS	151143

१२/३/२०२०

22/5/23

S.L No	SBD S.L No	MORD Ref No	DESCRIPTION	Unit	Quantity	Rate	Amount in Rs	Total Material Qty required (Cum)	Total Amount	Add 10 % Seigniorage Fee
--------	------------	-------------	-------------	------	----------	------	--------------	-----------------------------------	--------------	--------------------------

construction of subgrade and Earthen shoulders with approved material obtained from borrow pits with all lifts and lead, transporting to size, spreading, grading to required slope and compacted to meet requirement of Table 300.2 with lead upto 1000 m as Technical specification clause 303.1.

unit = cum

Taking output = 100 cum

Compensation for earth taken from private land

Cost for 100 cum = a

Rate per cum = (a)/100

100	34.82	3482
		3482
		34.82
		34.82

Cum

68.07
68.39

Providing Brick bats including spreading laying hand packing and compacting with C.I

Taking Out put = 2.832

Material

III) Local Sand

Cost for 300 cum =A

Rate per cum = (A) /2.832

0.63	141.85	89.37
		89.37
		31.56
		31.56

Cum

185.19
186.05
254.44

700/2.832
247.5

5/3/22

Total Seigniorage Fee