

कार्यपालक अभियंता का कार्यालय,
ग्रामीण कार्य विभाग, कार्य प्रमंडल,
मुजफ्फरपुर पूर्वी-1

पत्रांक..... 384/3-130

दिनांक..... 5/03/2022

प्रेषक,

कार्यपालक अभियंता,
ग्रामीण कार्य विभाग, कार्य प्रमंडल,
मुजफ्फरपुर पूर्वी-1

सेवा में,

अपर मुख्य कार्यपालक पदाधिकारी-सह-सचिव
बिहार ग्रामीण पथ विकास अभिकरण,
बिहार पटना।


विषय: नई अनुरक्षण नीति 2018 अंतर्गत वित्तीय वर्ष 2021-22 में अनुरक्षण मद में व्यय हेतु आवंटन की मांग।

महाशय,

उपर्युक्त विषय के संबंध में नई अनुरक्षण नीति 2018 अंतर्गत वित्तीय वर्ष 2021-22 में अनुरक्षण मद में व्यय हेतु संलग्न विवरणी के अनुसार **41.87850** (एकतालिस लाख सतासी हजार आठ सौ पचास) रुपये का आवंटन उपलब्ध कराने की कृपा की जाये ताकि किये गये कार्यों का भुगतान किया जा सके।

अनुलग्नक:- यथोक्त।

विश्वासभाजन


5.3.22

कार्यपालक अभियंता,
ग्रामीण कार्य विभाग, कार्य प्रमंडल,
मुजफ्फरपुर पूर्वी-1

Maintenance Requisition Formate for Scheme Head- MR (3054) Under Bihar Rural Road Maintenance Policy-2018

Executive Engineer
R.W.D. Works Division
Muzaffarpur East-1

Name Of Road:- nh-28 durga mandir - bangra bazid via sherpur majhailipali

Date	Time	Section No.	Length in km	Bumps in mm	Speed Rate	ORn MM/Km	TEGORY	Latitude	ongitude	Event
						UIV	ROAD			
29/11/21	12:38:32	68	0.1	360	0	3600	3546 G	26.8704	85.39549	Normal
29/11/21	12:39:7	68	0.1	150	20.2	1500	1469 G	26.86197	85.39594	Normal
29/11/21	12:39:7	68	0.1	350	10.1	3500	3447 G	26.85312	85.39613	Normal
29/11/21	12:40:0	68	0.1	380	10.1	3800	3744 G	26.84368	85.39608	Normal
29/11/21	12:40:18	68	0.1	310	10.1	3100	3052 G	26.83495	85.39611	Normal
29/11/21	12:40:53	68	0.1	360	10.1	3600	3546 G	26.82543	85.39606	Normal
29/11/21	12:41:0	68	0.1	290	10.1	2900	2854 G	26.8162	85.39594	Normal
29/11/21	12:41:28	68	0.1	360	10.1	3600	3546 G	26.80697	85.39608	Normal
29/11/21	12:42:2	68	0.1	360	10.1	3600	3546 G	26.7977	85.39598	Culvert
29/11/21	12:42:38	68	0.1	210	10.1	2100	2063 G	26.78897	85.39598	Normal
29/11/21	12:43:0	68	0.1	350	10.1	3500	3447 G	26.78012	85.39603	Normal
29/11/21	12:43:13	68	0.1	210	10.1	2100	2063 G	26.7715	85.39601	Normal
29/11/21	12:43:13	68	0.1	210	30.3	2100	2063 G	26.76225	85.39601	Normal
29/11/21	12:43:48	68	0.1	230	20.2	2300	2261 G	26.7528	85.39609	Normal
29/11/21	12:44:0	68	0.1	180	20.2	1800	1766 G	26.74398	85.39638	Normal
29/11/21	12:44:0	68	0.1	180	10.1	1800	1766 G	26.7345	85.39636	Normal
29/11/21	12:49:41	68	0.1	230	0	2300	2261 G	26.8553	85.39663	Normal
29/11/21	12:50:0	68	0.1	290	20.2	2900	2854 G	26.86408	85.39705	Normal
29/11/21	12:50:16	68	0.038	150	20.2	3947	3890 G	26.86668	85.39731	Normal
Avg						2799.15				

$$Y = 0 * X^2 + 0.989 * X - 13.58$$

$$X = 3947$$

$$Y = 3890$$


(R) RURAL ROAD

Good Average Poor
<4000 4001-5000 >5001

Signature
4/3/2022
JG

File : C:\Users\BRRDA58\OneDrive\Desktop\RAJNISH KUMAR\EAST1\29111258.Xls. Section No. : 68. Eqn : $Y = 0$

Name of Customer : RAJNISH KUMAR. Name of Work/ Road : NH 28 DURGA MANDIR SE BANGRA BAJID BHAYA

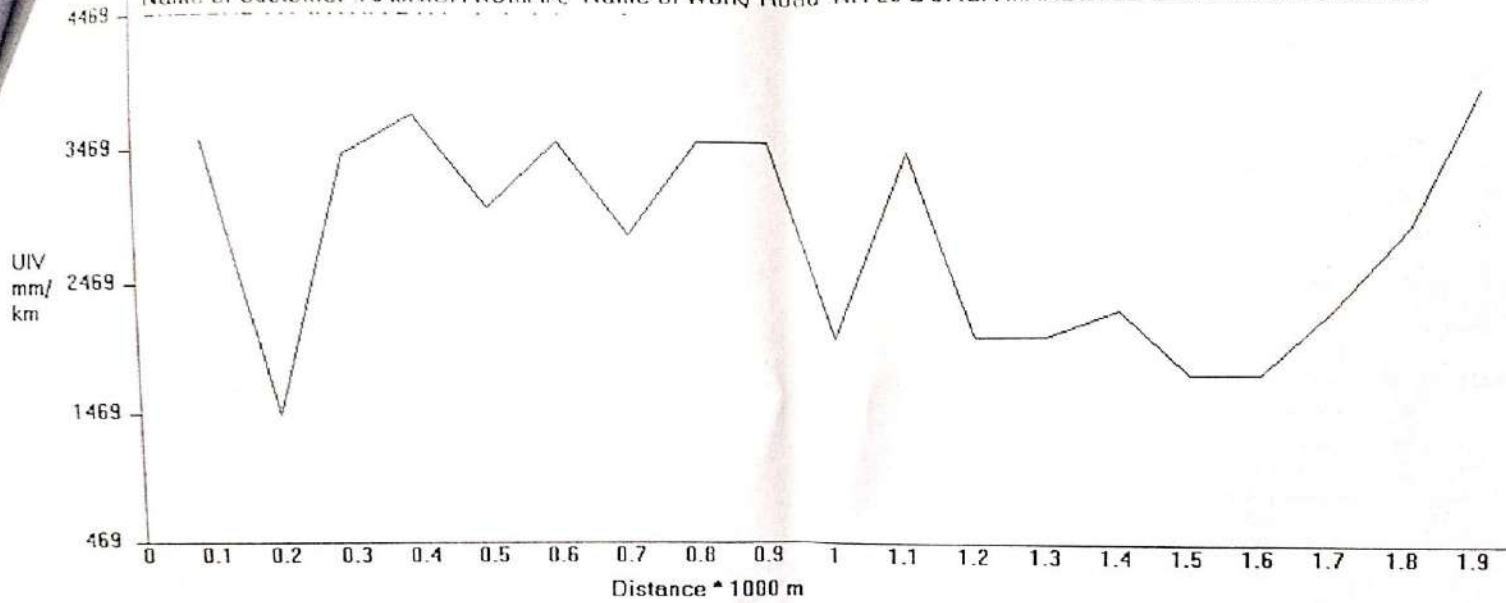

Rajnish Kumar
4/3/2022
E

Requisition Format for Scheme Head - MR (3054) Under Bihar Rural Road Maintenance Policy-2018 (Initial Rectification and Surface Renewal)

Name of Works Division :- Muzaffarpur East-1

Government of Bihar
OM01
Rural works Department

SUMMARY OF ORDINARY MAINTENANCE INSPECTION REPORT

Road From- ~~Bahara~~ - nh-28 durga mandir - bangra bazid via
sherpur majhailipali
Length of Road: 1.90 KM
Period : From
Inspector: A.E RWD Sub Division, Mushari

To: Executive Engineer
RWD Works Division Muzaffarpur East-1
Position: A.E

Date:

Standard Work item		Work	Units of work required in each kilometre										Comments
S No	Name	Units	1	2	3	4	5	6	7	8	9	10	
OM100 Sealed Pavement													
OM101	Pothole Patching	m2	Nil	Nil	Nil	Nil							No Pothole found.
OM102	Surface Depression and Rut Patching	m2	Nil	Nil	Nil	Nil							No Surface Depression and Rut Patching found
OM103	Crack Sealing	Lm	Nil	Nil	Nil	Nil							No Crack Sealing found
OM104	Surface Treatment												
	(a) Loss of Aggregate (Surface Ravelling)	m2	Nil	Nil	Nil	Nil							No Loss of Aggregate (Surface Ravelling) found
	(b) Bleeding/Flushing	m2	Nil	Nil	Nil	Nil							No Bleeding/Flushing Required
	(c) Crocodile Cracking	m2	Nil	Nil	Nil	Nil							No Crocodile Cracking found
OM105	Edge Repair	m2	Nil	Nil	Nil	Nil							No Edge Repair Required
OM106	Digouts	m2	N/A	N/A	N/A	N/A							
OM107	Concrete Pavement	m3	N/A	N/A	N/A	N/A							
	Other activities	Lm											
OM200 Shoulder													
OM201	Unsealed Shoulder	No											
	(a) Edge Drop off	Lm	Nil	Nil	Nil	Nil							No Edge Drop off Required
	(b) Roughness, Scouring or Potholes	Lm	Nil	3%	2%	Nil							Defects rectified within stipulated time.
	(c) Holding Water	Lm	Nil	Nil	Nil	Nil							No Holding water found
OM202	Embankment Repair	No	Nil	Nil	Nil	Nil							No Embankment Repair Required
	Other Activite (Raincut)		3%	1%	2%								Defects rectified within stipulated time.
OM 300 Drainage including culverts major													
OM301	Surface Drains & Verge	Lm	N/A	N/A	N/A	N/A							Not Required
OM302	Culvert Cleaning	Lm											Culvert maintain within stipulated time
OM303	Culvert and Pit repair	m2	Nil	Nil	Nil	Nil							Not Required

	Other activities (White Washing)	m2	Nil	Nil	Nil	Nil							Not Required
	OM 400 Vegetation												
OM401	Grass Control												
	a) Roadside-General Tidy	Ha	Nil	Nil	Nil	Nil							Not Required
	b) Clear near Safety signs, kilometre posts and roadside furniture	Ha	Nil	Nil	Nil	Nil							Not Required
OM402	Tree and shrub management	No	Nil	Nil	Nil	Nil							Not Required
	Cutting trees	No	Nil	Nil	Nil	Nil							Not Required
	Cutting Shrubs	No	Nil	Nil	Nil	Nil							Not Required
	Other activities (Trimming of Grass)	M2	Nil	Nil	Nil	Nil							Not Required
OM500	Safety Signage and Road												Not Required
OM501	Signs Maintenance	No	Nil	Nil	Nil	Nil							Not Required
OM502	Guard Stones	Lm	N/A	N/A	N/A	N/A							Not Applicable
OM503	Distance Stones	No	N/A	N/A	N/A	N/A							Not Applicable
OM504	Road Marking	m2	Nil	Nil	Nil	Nil							Not Required
	Other activities												

27/01/21 मुमाल
Bidder

Appendix
4/3/2022
LE

Executive Engineer, Rural Work Department, Work
Division, Muzaffarpur East I