

Dhamdaha

DIVISION

Rupauli

SUB-DIVISION

Lot 58 Lachmipuri to Nagarawasa**MEASUREMENT BOOK**

No. 56

प्रमाणित किया जाता है कि इस मापी
पुस्तक में सुविधा 1 से 50 वर्ग है। यह
मापी पुस्तक सबर प्रमंडल सुपौली
पट्टाधिकारी के नाम निगत किया जाता
है।

Name of Officer

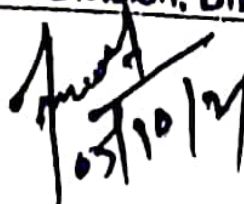


05.10.21

Date of first entry

Executive Engineer**Rural Works Department**

Date of last entry

Works Division, Dhamdaha (Purnea)


1

Name to work—
 Situation of work—
 Agency by which work is executed—
 Date of measurement—
 No. and date of agreement.
 (These four lines should be repeated at the commencement of the measurements relating to each work.)

Particulars	Details of actual measurement				Contents of area
	No.	L.	B.	D.	
M/works for to 1058- Laxmipur to Nagayawas.					
Authority- E.E R.W.D works Division, Dhamsdaha.					
① providing labour for driving 6mm to 75mm dia. Bamboo piles including cutting to in proper size and shoes etc do-do comp over					
	2X	30	X	2.52	150.0m
	1X	10	X	2.50	25.0m
					175.0m
② Supply fitting and fixing of Bamboo 62mm to 78mm dia. Remains fixed at every vertical pile do-do comp job					
	2X	310	X	30	180.0m
	1X	3.0	X	10	30.0m
					210.0m
③ supply fitting and fixing in position 80/100 dia. bamboo wooden chairs and 15/16 to 50 dia. 10/12					
	2X	30	X	1.50	90.0m ²
	1X	10	X	1.50	15.0m ²
Continuation					105.0m ²

Particulars	Details of actual measurement				Contents of area
	Np.	L.	B.	D.	
④ providing and filling empty centrif. bag with local sand, sticking the bag and Plaga etc. do. do comp. jobs					
	2	30	0.60	0.98	35.28 m^3
	1	10	0.60	0.98	5.88 m^3
					41.16 m^3
		$\frac{41.16}{0.034}$			$= 1210.58 \text{ kg}$
		847	2	1211	kg
					limit: 1208 kg

⑤ Providing and filling empty
specially laying Comp. jobs

with hammer all over					
do do comp. jobs					
	2	30	(0.65 + 0.75 + 1.75 + 1.25 + 1.5)		
			5		
			X (0.60 + 1.20 + 1.55 + 2.45 + 1.70)		
	2	30	1.180	1.50	106.20 m^3
	1	10	(0.65 + 0.75 + 1.75 + 1.25 + 1.5)		
			5		
			X (0.60 + 1.20 + 1.55 + 1.70 + 2.45)		
	1	10	1.180	1.50	17.70 m^3
					123.90 m^3
					$12.10.24$
					$12.10.24$

J. Executive Engineer
Continental Works Department
Works Division Dhamdaha (Pune)

Particulars	Details of actual measurement				Contents of area
	No.	L.	B.	D.	
<u>ABSTRACT OF CV</u>					
N/10000	For to 1058	Leamifur			
	to Nagre wase.				
Authority	E. E. R. W. P. Coorke				
	Division Dharmadik.				
① Providing bamboo piles including labour for cutting of 62 mm to 75 mm dia bamboo piles.					
	do - do comp job.				
175.0 m ²	P - ①				
@ 52.64/m ²				Sp. 9212 = 0	

② Providing and fixing and heavy split bamboo woven Charuri do do comp job.					
	105.0 m ²	P - ①			
	@ 458.11/m ²			Sp. 48102 = 0	
③ Supply fitting and fixing 62 mm to 75 mm dia bamboo Runes in position of all vertical piles.					
	do - do - comp job				
	210.0 m	P. - ①			
	@ 30.41/m ²			Sp. 6325 = 0	

Continuation

Rs 631639.10

Particulars	Details of actual measurement				Contents of area
	No.	L.	B.	D.	
④ providing and filling empty Cement by water level sand, stiching the long and Piling, making supply do. the - comp job					
1208 nos P-②					
C 41.16/11					Rs. 49721.00
⑤ providing and spreading brick bats in road ditched all do. do comp job					
123.90 m ² P-②					
C 2188.35/m ³					Rs. 27137.00
					Rs. 384497.00
C Add 12 v. 45.5					Rs. 46140.00
C Add 1 v. 4.55					Rs. 3845.00
C Add 10 v. 5.5					Rs. 17567.00
					Rs. 45,2049.00
12/12/2021					12/12/2021
J.E.					AE

Continuation

Date:

1. Name of PIUs-

Inspection Report for flood damage work
04.12.2021
Dhamdaha.

year (2021-22)

2. Name of Block/Road-

Rupauli/ 1058- Lachmipur to Nagaiwara (R-58)

A. For Road

1. Damage Location/Chainage :

2. Damage Length

3. Nature of Damage

4. Details of Restoration

i Material being used in Restoration

ii Equipment/Tools being used in Restoration works:

iii Procedure taken up in Restoration works

iv Restored Length

70 mtr

side crust cutting due to flood.

: Sand Bag, bamboo pile, Bricks bats.

: Tractor, J.C.B

: Manual.

: 70 mtr (R-4527049-00)

B. For Bridge

1. Damage Location/Chainage :

2. Damage Length

3. Nature of Damage

4. Details of Restoration

i Material being used in Restoration

ii Equipment/Tools being used in Restoration works:

iii Procedure taken up in Restoration works

iv Restored Length

सतोष प्रव

Signature of JE/AD/EE

4-12-21
Executive Engineer,
Rural Works Department
Works Division Dhamdaha (Purnea)

Signature

(Name of)

Executive Engineer
R.W.D. (Works) Division
PURNEA