

कार्यपालक अभियंता का कार्यालय

ग्रामीण कार्य विभाग

कार्य प्रमंडल सोनपुर

पत्रांक..... 1779 अजु० सोनपुर, दिनांक..... 21.10.2022

प्रेषक,

कार्यपालक अभियंता

ग्रामीण कार्य विभाग

कार्य प्रमंडल सोनपुर

सेवा में,

अपर मुख्य कार्यपालक

पदाधिकारी-सह-सचिव,

बिहार ग्रामीण पथ विकास अभिकरण

(BRRDA)

बिहार, पटना।

विषय:- बिहार ग्रामीण पथ अनुरक्षण निति-2018 योजनान्तर्गत अनुरक्षण हेतु राशि की अधियाचना के संबंध में।

महाशय,


उपर्युक्त विषय के संबंध में कहना है कि बिहार ग्रामीण पथ अनुरक्षण निति-2018 के अंतर्गत पथों का अनुरक्षण की राशि की मांग रुपये 16,10,433.00 (सोलह लाख दस हजार चार सौ तैतीस) मात्र विहित प्रपत्र में अंकित कर आवश्यक कार्रवाई हेतु समर्पित किया जा रहा है।

अनुरोध है कि उपर्युक्त योजना में आवंटन उपलब्ध कराने की कृपा की जाये। कार्य का निरीक्षण किया गया कार्य संतोषप्रद है। उक्त पथ में ए0टी0आर0 लंबित नहीं है।

अनु0:-Standard Formate for Roads

Quarterly Statement

विश्वासभाजन



कार्यपालक अभियंता

ग्रामीण कार्य विभाग

कार्य प्रमंडल सोनपुर

21/10/22

FORM GER 19-A

(See Government of India's Decision (I) below Rule-150
Form of Utilization Certificate up to the month of **October-2022**

PIU:- E.E.,R.W.D. Works Division Sonapur.

Sl. No.	Name of Scheme	Sanction No. & Date with Amount (in lacs Rs.)	Amount Received (in lac Rs.)	Particulars
1	2	3	4	5
1	Construction of Rural Roads under New Maintenance Policy-18 (Maintenance)		66.42492	Certified that out of Rs 66.42492 lakh received during the years 2020-21 to 2022-23 in favour of E.E.R.W.D. works division Sonapur a sum of Rs 66.35226 Lakh has been utilized for the purpose of New Maintenance Policy-18 (Maintenance) Scheme as given in the margin for which it was sanctioned and that the balance of Rs 0.07266 Lakh remaining unutilized at the end of the period under report.

Certified that I have satisfied that the condition of which the grants-in-aid was sanctioned have been duly fulfilled/ are being fulfilled and that I have exercised the following checks to see that the money was actually for the purpose for which it was sanctioned.

Kind of Checks:-

- Words have been supervised be Executive/superintending Engineer.
 - Periodical inspection has been conducted by Executive Engineer/ superintending Engineer.
 - Construction material has been tested.
 - Measurements have been recorded in the MBS and test conducted by the Assistant Engineer/ Executive Engineer.
 - All other nodal formalities have been observed.
- 3 physical Progress achieved-
- Construction of Road Works.
 - Construction of CD works

D.A.O

R.W.D. Works Division Sonpur.

EXECUTIVE ENGINEER

R.W.D. Works Division Sonpur.

Maintenance Requisition Formate for Scheme Head- MR (3054) Under Bihar Rural Road Maintenance Policy-2018

of Works Division:- SONPUR

of Works Division:- SONPUR																															
Road Details				AA Details										Agreement							Actual Maintenance Expenditure							Current Maintenance Demand		Remarks	
Name of Raods	Batch No.	Project ID	Actual Date of Completion	Main Work Amount (in Lakh)	Maintenman ce Amount (in lakh)	Main Work Amount (in Lakh)	Agre t-1	Agree ment-2	Agree ment-3	Agreement-4	Agree ment-5	Total Mainten ance	Length (in KM)	1st. Year Maint enance	2nd. Year Mainte nance	3rd. Year Mainte nance	4th Year Mainte nance	5th Year Mainte nance	Total Maint as per Bump Report	Length as per bump Report	IRL As per bump Report	1st QTR Maint enance	2nd QTR Mainte nance	3rd QTR Mainte nance	4th QTR Mainte nance	Total					
1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	30	31				
1	PARASA HOSPITAL - HASANPURA BISHUNPU	RMSA/SON /19/0003	31306402059	15.01.2021	182.90000	93.90000	178.09500	16.61497	16.61497	16.61497	16.61497	16.61497	83.07485	8.16	0.000	0.000	0.000	0.000	0.000	0.000	8.16	1416.00	4.15374	4.15374	4.15374	0.00000	12.46123				
2	Baksanda - Gangui	RMSA/SON /19/0003	NEA220002172	25.03.2021	80.30400	41.79900	82.01900	7.28620	7.28620	7.28620	7.28620	7.28620	36.43100	3.35	0.000	0.000	0.000	0.000	0.000	0.000	3.35	2227.00	1.82155	1.82155	0.00000	0.00000	3.64310				
Total																														16.10433	

[Signature]
21.10.22

Executive Engineer
R.W.D. Works Division
SONPUR

[Signature]
21/10/22

STANDARD FORMAT FOR ROADS QUARTERLY STATEMENT

1	Name of the Road	PARASA HOSPITAL - HASANPURA BISHPUNPUR		
2	Batch No.	RM/SA/SON/19/0003		
3	Project ID	31306402059		
4	Total Length of Road (in Km)	8.160		
5	Length of Road to Meet Required Service Level [Completed length] (in Km) (1)	8.160		
6	No. of Total Quarter (ie 3 Months as a unit) in 5 years	20		
7	Ordinary Maintenance Cost as per Schedule (Agreement Amount for Maintenance) (in Lakh)	83.07488		
8	Quarterly Payment : 1/20 of Ordinary Maintenance Cost as per Schedule (in Lakh) (2)	4.15374		
Compliance Criteria	Standard Job Description	Non-Compliant		Reduction Payment (6) = (3) / (1) * (2) * (4)
		Length Non Compliant (3)	Weighted Value for Payment Reduction (%) (4)	
I	PAVED ROADS (CARRIAGEWAY)	0	60%	0.00000
II	SHOULDERS AND EMBANMENTS	0	10%	0.00000
III	CROSS DRAINAGE INCLUDING CULVERTS AND BRIDGES	0	15%	0.00000
IV	SIGNAGE AND ROAD SAFETY	0	10%	0.00000
V	VEGATAION		5%	0.00000
TOTAL PAYMENT REDUCTION FOR THE QUARTER (in Lakh) [5]				0.00000
TO BE PAID FOR THE QUARTER/DEMAND (in Lakh) [6]				4.15374

Date of inspection by E/1 or his agent Prepared by
Contractor's self Control unit

Date

Signature of person inspecting road

Name and Designation of person inspecting road
(Signature)

Certify by E/I (signature) Date

Requisition Format for Scheme Head - MR (3054) Under Bihar Rural Road Maintenance Policy-2018 (Initial Rectification and Surface Renewal)

III Quater

Name of Works Division :- Sonpur

Government of Bihar

OM101

Rural works Department

Road From- PARASA HOSPITAL - HASANPURA

BISHPU/NP/R

Length of Road: 8.160 KM

Period: From.....

Inspector: A.E RWD Sub Division, Parsa

SUMMARY OF ORDINARY MAINTENANCE INSPECTION REPORT

To: Executive Engineer

RWD Works Division Sonpur

Date:

Position: A.E

S No	Standard Work item	Work Units	Units of work required in each kilometre										Comments
			1	2	3	4	5	6	7	8	9	10	
OM101	OM100 Sealed Pavement												
	Pothole Patching	m ²											No. Pothole found
	Surface Depression and Rut Patching	m ²											No Surface Depression and Rut Patching found
	Crack Sealing	Lm											No Crack Sealing found
OM103	Surface Treatment												
	(a) Loss of Aggregate (Surface Ravelling)	m ²											No Loss of Aggregate (Surface Ravelling) found
	(b) Bleeding/Flushing	m ²											No Bleeding/Flushing Required
	(c) Crocodile Cracking	m ²											No Crocodile Cracking found
OM104	Edge Repair	m ²											No Edge Repair Required
OM105	Digouts	m ²											
OM106	Concrete Pavement	m ³											
OM107	Other activities	Lm											
OM200 Shoulder	Unsealed Shoulder	No											
	(a) Edge Drop off	Lm											No Edge Drop off Required
	(b) Roughness, Scouring or Potholes	Lm											Not required
	(c) Holding Water	Lm											No Holding water found
OM201	Embankment Repair	No											No Embankment Repair Required
OM202	Other Activity (Raincut)												Defects rectified within stipulated time.
OM 300 Drainage including culverts major													
OM301	Surface Drains & Verge	Lm											Not Required
OM302	Culvert Cleaning	Lm											Culvert maintain within stipulated time
OM303	Culvert and Pit repair	m ²											Not Required

Signature
16/10/24

21/10/24

Name of work : PARASA HOSPITAL - HASANPURA BISHPUNPUR

Name of customer : Indu kumari

(R/R) Rural Road		
Good	Average	Poor
< 4000	4001 - 5000	> 5000

Date	Time	Test No	Distance(m)	Total Distance(m)	BUMP(cm)	Speed(Km/Hr)	U/(mm/Km)	Corrected U (mm/Km)	IRI	Status	Latitude	Direction	Longitude	Direction1	Remarks
25/06/22	14:52:57	44	100	100	10.0 cm	19.8 Km/Hr	1000.0 mm/Km	1055	1.59	Good	25.8903857	N	85.0356455	E	Normal
25/06/22	14:53:16	44	100	200	19.0 cm	18.8 Km/Hr	1900.0 mm/Km	1890	2.67	Good	25.8911715	N	85.0359583	E	Normal
25/06/22	14:53:32	44	100	300	22.0 cm	22.2 Km/Hr	2200.0 mm/Km	2169	3.02	Good	25.8920832	N	85.0359049	E	Normal
25/06/22	14:53:46	44	100	400	22.0 cm	24.4 Km/Hr	2200.0 mm/Km	2169	3.02	Good	25.8929625	N	85.0358591	E	Normal
25/06/22	14:54:00	44	100	500	19.0 cm	27.2 Km/Hr	1900.0 mm/Km	1890	2.67	Good	25.8939543	N	85.0358057	E	Normal
25/06/22	14:54:14	44	100	600	18.0 cm	24.6 Km/Hr	1800.0 mm/Km	1798	2.55	Good	25.8945284	N	85.0363321	E	Normal
25/06/22	14:54:27	44	100	700	21.0 cm	28.0 Km/Hr	2100.0 mm/Km	2076	2.9	Good	25.8946429	N	85.0374689	E	Normal
25/06/22	14:54:40	44	100	800	27.0 cm	27.6 Km/Hr	2700.0 mm/Km	2633	3.59	Good	25.8947554	N	85.0383768	E	Normal
25/06/22	14:54:53	44	100	900	21.0 cm	27.2 Km/Hr	2100.0 mm/Km	2076	2.9	Good	25.8947554	N	85.0383768	E	Normal
25/06/22	14:55:11	44	100	1000	16.0 cm	20.6 Km/Hr	1600.0 mm/Km	1612	2.31	Good	25.8954478	N	85.0388951	E	Normal
25/06/22	14:55:25	44	100	1100	19.0 cm	25.9 Km/Hr	1900.0 mm/Km	1890	2.67	Good	25.8954478	N	85.0388951	E	Normal
25/06/22	14:55:39	44	100	1200	14.0 cm	26.4 Km/Hr	1400.0 mm/Km	1426	2.07	Good	25.895903	N	85.0400095	E	Normal
25/06/22	14:55:53	44	100	1300	33.0 cm	24.7 Km/Hr	3300.0 mm/Km	3190	4.26	Good	25.8977881	N	85.0388951	E	Normal
25/06/22	14:56:07	44	100	1400	19.0 cm	25.2 Km/Hr	1900.0 mm/Km	1890	2.67	Good	25.8989516	N	85.0399256	E	Normal
25/06/22	14:56:22	44	100	1500	35.0 cm	23.9 Km/Hr	3500.0 mm/Km	3375	4.48	Good	25.8989516	N	85.0399256	E	Normal
25/06/22	14:56:36	44	100	1600	24.0 cm	26.4 Km/Hr	2400.0 mm/Km	2355	3.24	Good	25.8989516	N	85.0424356	E	Normal
25/06/22	14:56:50	44	100	1700	19.0 cm	26.2 Km/Hr	1900.0 mm/Km	1890	2.67	Good	25.9007788	N	85.0424356	E	Normal
25/06/22	14:57:03	44	100	1800	18.0 cm	27.0 Km/Hr	1800.0 mm/Km	1798	2.55	Good	25.9007788	N	85.0424356	E	Normal
25/06/22	14:57:22	44	100	1900	18.0 cm	19.4 Km/Hr	1800.0 mm/Km	1798	2.55	Good	25.9022055	N	85.0434580	E	Normal
25/06/22	14:57:38	44	100	2000	18.0 cm	21.6 Km/Hr	1800.0 mm/Km	1798	2.55	Good	25.9022055	N	85.0434580	E	Normal
25/06/22	14:57:52	44	100	2100	22.0 cm	25.7 Km/Hr	2200.0 mm/Km	2169	3.02	Good	25.9022055	N	85.0434580	E	Normal

15/11/22

Vijay Kumar
A.R.

21/11/22

Name of work : PARASA HOSPITAL - HASANPURA BISHPUNPUR

Name of customer : Indu kumari

(R)Rural Road

Good

Average

Poor

< 4000

4001 - 5000

> 5000

25/06/22	14:58:06	44	100	2200	28.0 cm	25.9 Km/Hr	2800.0 mm/Km	2726	3.7	Good	25.9033537	N	85.0456095	E	Normal
25/06/22	14:58:20	44	100	2300	36.0 cm	24.9 Km/Hr	3600.0 mm/Km	3468	4.59	Good	25.9037924	N	85.0466471	E	Normal
25/06/22	14:58:38	44	100	2400	20.0 cm	20.4 Km/Hr	2000.0 mm/Km	1983	2.78	Good	25.9045172	N	85.0469751	E	Normal
25/06/22	14:58:58	44	100	2500	21.0 cm	18.0 Km/Hr	2100.0 mm/Km	2076	2.9	Good	25.9052172	N	85.0477228	E	Normal
25/06/22	14:59:22	44	100	2600	24.0 cm	15.3 Km/Hr	2400.0 mm/Km	2355	3.24	Good	25.9056082	N	85.0476236	E	Normal
25/06/22	14:59:46	44	100	2700	16.0 cm	14.2 Km/Hr	1600.0 mm/Km	1612	2.31	Good	25.9062758	N	85.0482263	E	Normal
25/06/22	15:00:10	44	100	2800	16.0 cm	16.2 Km/Hr	1600.0 mm/Km	1612	2.31	Good	25.9065161	N	85.0488977	E	Normal
25/06/22	15:00:27	44	100	2900	17.0 cm	20.4 Km/Hr	1700.0 mm/Km	1705	2.43	Good	25.9066611	N	85.0500650	E	Normal
25/06/22	15:00:53	44	100	3000	15.0 cm	14.1 Km/Hr	1500.0 mm/Km	1519	2.19	Good	25.9074965	N	85.0509577	E	Normal
25/06/22	15:01:10	44	100	3100	17.0 cm	20.4 Km/Hr	1700.0 mm/Km	1705	2.43	Good	25.9074965	N	85.0509577	E	Normal
25/06/22	15:01:26	44	100	3200	13.0 cm	22.5 Km/Hr	1300.0 mm/Km	1334	1.95	Good	25.9093199	N	85.0501642	E	Normal
25/06/22	15:01:38	44	100	3300	20.0 cm	27.0 Km/Hr	2000.0 mm/Km	1983	2.78	Good	25.9102431	N	85.0498209	E	Normal
25/06/22	15:01:53	44	100	3400	28.0 cm	26.7 Km/Hr	2800.0 mm/Km	2726	3.7	Good	25.9105559	N	85.0495615	E	Normal
25/06/22	15:02:09	44	100	3500	11.0 cm	22.2 Km/Hr	1100.0 mm/Km	1148	1.71	Good	25.9109107	N	85.0487986	E	Normal
25/06/22	15:02:31	44	100	3600	26.0 cm	16.3 Km/Hr	2600.0 mm/Km	2540	3.47	Good	25.9116946	N	85.0477686	E	Normal
25/06/22	15:02:49	44	100	3700	22.0 cm	20.4 Km/Hr	2200.0 mm/Km	2169	3.02	Good	25.9123660	N	85.0477838	E	Normal
25/06/22	15:03:14	44	100	3800	22.0 cm	14.7 Km/Hr	2200.0 mm/Km	2169	3.02	Good	25.9128600	N	85.0468454	E	Normal
25/06/22	15:03:38	44	100	3900	35.0 cm	14.2 Km/Hr	3500.0 mm/Km	3375	4.48	Good	25.9130946	N	85.0459299	E	Normal
25/06/22	15:04:30	44	100	4000	19.0 cm	7.1 Km/Hr	1900.0 mm/Km	1890	2.67	Good	25.9131518	N	85.0450678	E	Normal
25/06/22	15:04:50	44	100	4100	24.0 cm	17.6 Km/Hr	2400.0 mm/Km	2355	3.24	Good	25.9121570	N	85.0441751	E	Normal
25/06/22	15:05:10	44	100	4200	29.0 cm	18.3 Km/Hr	2900.0 mm/Km	2819	3.81	Good	25.9124270	N	85.0438013	E	Normal
25/06/22	15:07:51	45	100	4300	26.0 cm	11.7 Km/Hr	2600.0 mm/Km	2540	3.47	Good	25.9047862	N	85.0412302	E	Normal

85/5/14/22
Kumari Indu
Kumari Indu

Name of work : PARASA HOSPITAL - HASANPURA BISHPUNPUR

Name of customer : Indu kumari

(R)Rural Road		
Good	Average	Poor
< 4000	4001 - 5000	> 5000

25/06/22	15:08:08	45	100	4400	15.0 cm	21.4 Km/Hr	1500.0 mm/Km	1519	2.19	Good	25.9048758	N	85.0397654	E	Normal
25/06/22	15:08:21	45	100	4500	19.0 cm	26.4 Km/Hr	1900.0 mm/Km	1890	2.67	Good	25.9048758	N	85.0397654	E	Normal
25/06/22	15:08:34	45	100	4600	16.0 cm	27.7 Km/Hr	1800.0 mm/Km	1612	2.31	Good	25.9051486	N	85.0377970	E	Normal
25/06/22	15:08:47	45	100	4700	13.0 cm	28.8 Km/Hr	1300.0 mm/Km	1334	1.95	Good	25.9053278	N	85.0368357	E	Normal
25/06/22	15:09:23	45	100	4800	36.0 cm	10.5 Km/Hr	3600.0 mm/Km	3468	4.59	Good	25.9051352	N	85.0358591	E	Normal
25/06/22	15:09:42	45	100	4900	20.0 cm	18.3 Km/Hr	2000.0 mm/Km	1983	2.78	Good	25.9044734	N	85.0353022	E	Normal
25/06/22	15:10:11	45	100	5000	22.0 cm	12.0 Km/Hr	2200.0 mm/Km	2169	3.02	Good	25.9040575	N	85.0348673	E	Normal
25/06/22	15:10:30	45	100	5100	13.0 cm	19.4 Km/Hr	1300.0 mm/Km	1334	1.95	Good	25.9033099	N	85.0342112	E	Normal
25/06/22	15:10:44	45	100	5200	14.0 cm	24.6 Km/Hr	1400.0 mm/Km	1426	2.07	Good	25.9025202	N	85.0336924	E	Normal
25/06/22	15:11:06	45	100	5300	28.0 cm	16.5 Km/Hr	2800.0 mm/Km	2726	3.7	Good	25.9023896	N	85.0327997	E	Normal
25/06/22	15:11:22	45	100	5400	16.0 cm	22.7 Km/Hr	1600.0 mm/Km	1612	2.31	Good	25.9015875	N	85.0322580	E	Normal
25/06/22	15:11:43	45	100	5500	13.0 cm	17.1 Km/Hr	1300.0 mm/Km	1334	1.95	Good	25.9007140	N	85.0315638	E	Normal
25/06/22	15:12:05	45	100	5600	19.0 cm	16.5 Km/Hr	1900.0 mm/Km	1890	2.67	Good	25.899815	N	85.0311670	E	Normal
25/06/22	15:12:19	45	100	5700	20.0 cm	24.6 Km/Hr	2000.0 mm/Km	1983	2.78	Good	25.8991671	N	85.0305185	E	Normal
25/06/22	15:12:42	45	100	5800	38.0 cm	16.0 Km/Hr	3800.0 mm/Km	3654	4.8	Good	25.8986216	N	85.0298014	E	Normal
25/06/22	15:13:03	45	100	5900	18.0 cm	17.1 Km/Hr	1800.0 mm/Km	1798	2.55	Good	25.8978892	N	85.0291376	E	Normal
25/06/22	15:13:29	45	100	6000	32.0 cm	14.4 Km/Hr	3200.0 mm/Km	3097	4.14	Good	25.8972674	N	85.0284357	E	Normal
25/06/22	15:13:46	45	100	6100	17.0 cm	20.2 Km/Hr	1700.0 mm/Km	1705	2.43	Good	25.8965140	N	85.0279169	E	Normal
25/06/22	15:14:00	45	100	6200	22.0 cm	24.9 Km/Hr	2200.0 mm/Km	2169	3.02	Good	25.8957034	N	85.0275202	E	Normal
25/06/22	15:14:14	45	100	6300	21.0 cm	26.4 Km/Hr	2100.0 mm/Km	2076	2.9	Good	25.8948660	N	85.0269709	E	Normal
25/06/22	15:14:36	45	100	6400	35.0 cm	16.8 Km/Hr	3500.0 mm/Km	3375	4.48	Good	25.8940440	N	85.0264139	E	Normal
25/06/22	15:15:08	45	100	6500	25.0 cm	11.1 Km/Hr	2500.0 mm/Km	2447	3.36	Good	25.8937102	N	85.0260096	E	Normal

15/11/22

15/11/22

15/11/22

Name of work : PARASA HOSPITAL - HASANPURA BISHPUNPUR

Name of customer : Indu kumar

(R)Rural Road		
Good	Average	Poor
< 4000	4001 - 5000	> 5000


25/06/22	15.15.23	45	100	6600	21.0 cm	23.1 Km/Hr	2100.0 mm/Km	2076	2.9	Good	25.8925257	N	85.0253077	E	Normal
25/06/22	15.15.37	45	100	6700	15.0 cm	25.7 Km/Hr	1500.0 mm/Km	1519	2.19	Good	25.8916368	N	85.0249720	E	Normal
25/06/22	15.17.19	45	100	6800	24.0 cm	3.7 Km/Hr	2400.0 mm/Km	2355	3.24	Good	25.8916808	N	85.0242548	E	Normal
25/06/22	15.17.31	45	100	6900	18.0 cm	28.2 Km/Hr	1800.0 mm/Km	1798	2.55	Good	25.8918829	N	85.0237284	E	Normal
25/06/22	15.17.42	45	100	7000	18.0 cm	32.0 Km/Hr	1800.0 mm/Km	1798	2.55	Good	25.8918829	N	85.0237284	E	Normal
25/06/22	15.17.55	45	100	7100	28.0 cm	29.4 Km/Hr	2800.0 mm/Km	2726	3.7	Good	25.8928881	N	85.0213251	E	Normal
25/06/22	15.18.08	45	100	7200	16.0 cm	25.9 Km/Hr	1600.0 mm/Km	1612	2.31	Good	25.8931075	N	85.0208368	E	Normal
25/06/22	15.18.20	45	100	7300	14.0 cm	31.2 Km/Hr	1400.0 mm/Km	1426	2.07	Good	25.8937426	N	85.0196466	E	Normal
25/06/22	15.18.31	45	100	7400	11.0 cm	32.4 Km/Hr	1100.0 mm/Km	1148	1.71	Good	25.8937426	N	85.0196466	E	Normal
25/06/22	15.18.41	45	100	7500	17.0 cm	34.5 Km/Hr	1700.0 mm/Km	1705	2.43	Good	25.8947154	N	85.0178385	E	Normal
25/06/22	15.18.52	45	100	7600	20.0 cm	34.9 Km/Hr	2000.0 mm/Km	1983	2.78	Good	25.8951788	N	85.0169611	E	Normal
25/06/22	15.19.01	45	100	7700	11.0 cm	36.0 Km/Hr	1100.0 mm/Km	1148	1.71	Good	25.8954592	N	85.0164728	E	Normal
25/06/22	15.19.11	45	100	7800	14.0 cm	37.4 Km/Hr	1400.0 mm/Km	1426	2.07	Good	25.8954592	N	85.0164728	E	Normal
25/06/22	15.19.35	45	100	7900	15.0 cm	16.2 Km/Hr	1500.0 mm/Km	1519	2.19	Good	25.8966592	N	85.0146189	E	Normal
25/06/22	15.19.49	45	100	8000	19.0 cm	23.9 Km/Hr	1900.0 mm/Km	1890	2.67	Good	25.8972502	N	85.0141458	E	Normal
25/06/22	15.20.00	45	100	8100	12.0 cm	32.4 Km/Hr	1200.0 mm/Km	1241	1.83	Good	25.8977843	N	85.0135279	E	Normal
25/06/22	15.20.12	45	100	8200	19.0 cm	31.5 Km/Hr	1900.0 mm/Km	1890	2.67	Good	25.8987437	N	85.0122538	E	Normal

15/10/22

15/10/22

15/10/22

Name of Customer: Indu kumari , Machine no: 19205 , Road: PARASA HOSPITAL , HASANPURA BISHPINPUR , Date: 25-06-22 , Section No: 44 , Equation: $V=0.928X+127.3$

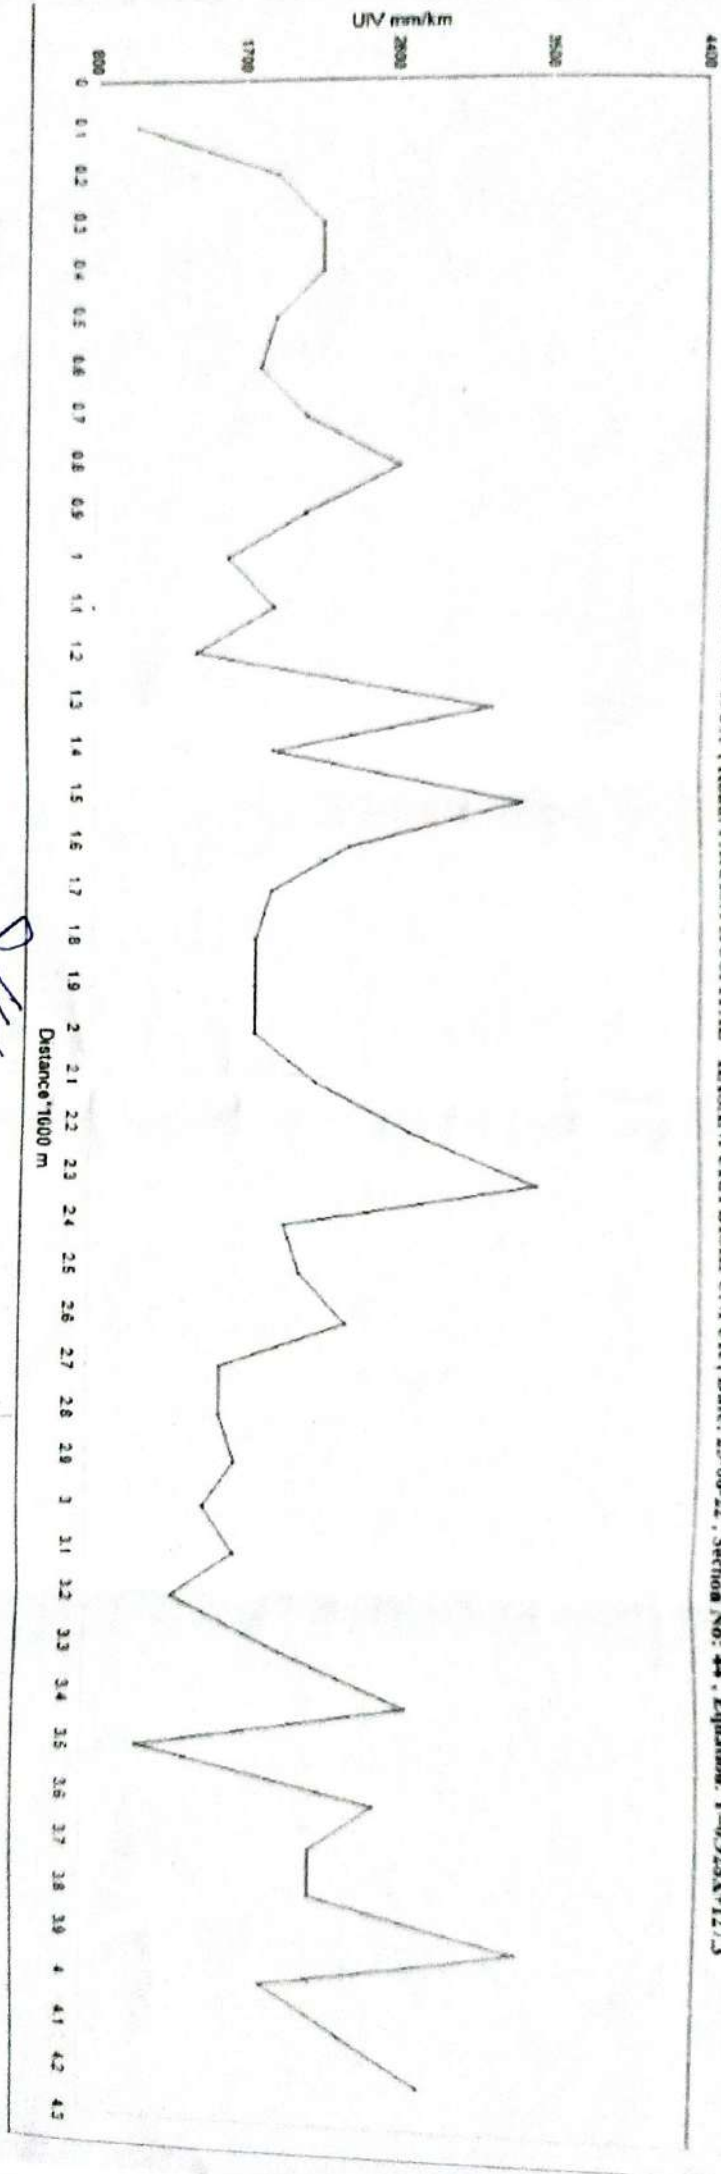

15/10/22

15/10/22

21/10/22