

3rd Year Maintenance.

78

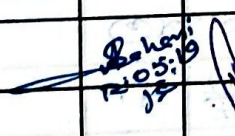
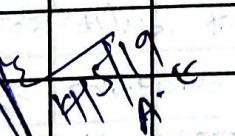
Sch. XLV—Form No. 134

Particulars	Details of actual measurement				Contents of area
	No.	L.	B.	D.	
Name of work: - Constn of road from PWD					
Road to Gherghatta. UNDER-MMGSY.					
Name of agency: - M/s. Chandan Bhushan Singh.					
Agreement No. :- 26 SBD/2013-14.					
Date of start: - 06.09.13					
Date of Completion: - 05.09.14.					
Actual Date of completion: - 15.05.16.					
Date of entry: - 12.05.19					
① Restoration of					
drainage with soil-dld.					
	36	30.00	1.00	0.20	= 216.00 m ³
	1	22.00	1.00	0.20	= 4.40 m ³
	36	30.00	1.00	0.20	= 216.00 m ³
	1	22.00	1.00	0.20	= 4.40 m ³
					440.80 m ³
② Maintenance of Earthen					
Shoulder dld.					
	45	30.00	0.90		= 1215.00 m ²
	1	11.00	0.90		= 9.90 m ²
	45	30.00	0.90		= 1215.00 m ²
	1	11.00	0.90		= 9.90 m ²
					2449.80 m ²
③ Repair of Pot holes					
providing Jack coat,					
20 mm premix Carpet					
& Seal Coat Type B.					
	2	5.00	2.00		= 20.00 m ²
	1	5.50	2.00		= 11.00 m ²
	2	6.00	1.55		= 18.60 m ²
	2	4.00	1.75		= 14.00 m ²

Continuation

c.o. Area = 63.60 m²

Sch. XLV—Form No. 134

Particulars	Details of actual measurement				Contents of area
	No.	L.	B.	D.	
③	<u>Continued.</u>			B.F. Area	63.60 m ²
	4x	3.00x	1.50		= 18.00 "
	3x	4.50x	1.55		= 20.925 "
	3x	4.00x	1.50		= 18.00 "
	5x	2.50x	2.00		= 25.00 "
	9x	2.00x	1.50		= 27.00 "
	10x	1.50x	1.25		= 18.75 "
					<u>191.275 m²</u>
④	Maintenance of Slab				
	Culvert				6 Nos.
⑤	Repair of WBM Surface				
	Top Layer Gr-II				
	2x	5.00x	2.00x	0.075	= 1.500 m ³
	1x	5.50x	2.00x	0.075	= 0.825 "
	2x	6.00x	1.55x	0.075	= 1.335 "
	2x	4.00x	1.75x	0.075	= 1.050 "
	4x	3.00x	1.50x	0.075	= 1.350 "
	3x	4.50x	1.55x	0.075	= 1.569 "
	3x	4.00x	1.50x	0.075	= 1.350 "
	5x	2.50x	2.00x	0.075	= 1.875 "
	9x	2.00x	1.50x	0.075	= 2.025 "
	10x	1.50x	1.25x	0.075	= 1.406 "
					<u>14.345 m³</u>
					
					

Continuation

Particulars	Details of actual measurement				Contents of area
	No.	L.	B.	D.	
<u>ABSTRACT OF COST.</u>					
①	Restoration of main cuts & drains				
	V.P. $\frac{78}{1}$ 440.80 m ²				
	@ Rs. 282 = 71/m ² Rs. 1,24,618 = 57				
②	Maintenance of earthen shoulder (filling with fresh selected soil)				
	V.P. $\frac{78}{2}$ 2449.80 m ²				
	@ Rs. 23 = 93/m ² Rs. 58,623 = 71				
③	Repair of WBM Surface Top layer 80-III				
	N.P. $\frac{79}{5}$ 14.345 m ³				
	@ Rs. 2454 = 71/m ³ Rs. 35,212 = 81				
④	Repairs of foot holes providing Jack coat, 20 mm premium carpet & seal coat Type B.				
	V.P. $\frac{79}{3}$ 191.275 m ²				
	@ Rs. 216 = 57/m ² Rs. 41,424 = 43				
⑤	Maintenance of slab Culvert.				
	V.P. $\frac{79}{4}$ 6 Nos.				
	@ Rs. 774 = 52 each Rs. 4,647 = 12				
	Rs. 2,64,526 = 64				
	less 5.51% @ Rs. 14,575 = 42				
	Rs. 2,49,951 = 22				
	Pay Rs. 2,49,951 = 00				
Rs. 12.05.19 A.C.					

Continuation

A/E