

Sch. XLV—Form No. 134

Sch. XLV—Form No. 134					Contents of area
Particulars	Details of actual measurement				
	No.	L.	B.	D.	
Name of work:- Construction of road from PWD to Ghoghghatta.					
Under - MMGSY.					
Name of agency:- M/s Chandra Bhushan Singh.					
Agreement No.:- 2688D/2013-14					
Date of start:- 06.09.12.					

Actual Date of Completion:- 15.05.16.

Date of entry:- 15.05.2021

① Restoration of joints

With Soil - do do.

$$48 \times 30.00 \times 1.00 \times 0.200 = 288.00 \text{ m}^3$$

$$1 \times 15.00 \times 1.00 \times 0.200 = 3.00 \text{ m}^3$$

$$46 \times 30.00 \times 1.00 \times 0.200 = 276.00$$

567.00 m³

②

Maintenance of earthen shoulder - do

$$58 \times 30.00 \times 0.90 = 1566.00 \text{ m}^2$$

$$1 \times 20.00 \times 0.90 = 18.00 \text{ m}^2$$

$$58 \times 30.00 \times 0.90 = 1566.00$$

3150.00 m²

③

Repair of pot holes of WBM. Surface Top layer of Gr-3.

$$4 \times 2.00 \times 1.80 \times 0.075 = 1.08 \text{ m}^3$$

$$1 \times 8.00 \times 2.00 \times 0.075 = 1.20 \text{ m}^3$$

$$3 \times 5.00 \times 2.00 \times 0.075 = 2.25 \text{ m}^3$$

$$1 \times 10.00 \times 2.75 \times 0.075 = 2.06 \text{ m}^3$$

$$1 \times 15.00 \times 3.75 \times 0.075 = 4.22 \text{ m}^3$$

Continuation C.O. Q=10.81 m³.

Sch. XLV—Form No. 134

Particulars	Details of actual measurement				Contents of area
	No.	L.	B.	D.	
③ <u>Continued.</u>				B.F.	Q = 10.81 m ²
	3X	4.00X	2.20X	0.075 =	1.98 ~
	1X	18.00X	3.75X	0.075 =	5.06 ~
	4X	3.00X	2.00X	0.075 =	1.80 ~
	1X	6.00X	2.60X	0.075 =	1.17 ~
	6X	2.00X	1.50X	0.075 =	1.35 ~
	1X	14.00X	2.80X	0.075 =	2.94 ~
	1X	3.50X	2.40X	0.075 =	0.63 ~
	1X	2.86X	2.00X	0.075 =	0.42 ~
	1X	7.30X	2.60X	0.075 =	1.42 ~
	1X	11.00X	3.75X	0.075 =	3.09 ~
	2X	4.80X	2.60X	0.075 =	1.87 ~
	1X	7.20X	2.10X	0.075 =	1.13 ~
	1X	13.60X	1.80X	0.075 =	1.84 ~

35.51 m²

④	Repair of pot holes				
	providing back coat				
	20 mm ^{springer} premix carpet				
	with Seal coat ^{type B} - 2 coats				
	4X	2.00X	1.80		= 14.40 m ²
	1X	8.00X	2.00		= 16.00 ~
	3X	5.00X	2.00		= 30.00 ~
	1X	10.00X	2.75		= 27.50 ~
	1X	15.00X	3.75		= 56.25 ~
	3X	4.00X	2.20		= 26.40 ~
	1X	18.00X	3.75		= 67.50 ~
	4X	3.00X	2.00		= 24.00 ~
	1X	6.00X	2.60		= 15.60 ~
	6X	2.00X	1.50		= 18.00 ~

Continuation

i.e. Area = 295.65 m²

Sch. XLV—Form No. 134

Particulars	Details of actual measurement				Contents of area
	No.	L.	B.	D.	
④ <u>continued.</u>				B.F.	Area: 295.65 m ²
	1x	14.00	2.80		= 39.20
	1x	3.50	2.40		= 8.40
	1x	2.80	2.00		= 5.60
	1x	7.30	2.60		= 18.98
	1x	11.00	3.75		= 41.25
	2x	4.80	2.60		= 24.96
	1x	7.20	2.10		= 15.12
	1x	13.60	1.80		= 24.48
⑤	Total:				473.64 m ²
	Maintenance of drain				
	Culvert.				6 Nos.
	15.05				

ABSTRACT OF COST.

①	Restoration of rain cuts with soil			
	N.P. 86	567.00 m ³		
	①			
	@ Rs. 282 = 71/m ³			Rs. 1,60,297.00
②	Maintenance of earthen shoulder - chel.			
	N.P. 86	3150.00 m ²		
	②			
	@ Rs. 23 = 93/m ²			Rs. 75,379.00
③	Providing W.B.M Surface Top Layer Gr-B. - chel.			
	N.P. 87			
	③			
	Q = 35.51 m ³			
	@ Rs. 2454 = 71/m ³			Rs. 87,167.00

Continuation

C.O. Rs. 9,22,843.00


Sch. XLV—Form No. 134


Particulars	Details of actual measurement				Contents of area
	No.	L.	B.	D.	
				B.F.	Rs. 3,22,843.00
④ Repair of pot holes providing thick coat, 20mm open graded premix carpet with Seal Coat type 'B' stud.					
V.P.	BB	4	473.64 m ²		
Unit	to		319.57 m ²		
@ Rs. 216.57/m ²					Rs. 69,209.00
⑤ Maintenance of Slab Culvert duct					
V.P.	BB	5	6 Nos.		
@ Rs. 774 = 52 each					Rs. 4647.00

Rs. 3,96,699.00

less. 5.51% 6 Rs. 21,858.00

Rs. 3,74,841.00



 15.05.21
 JE

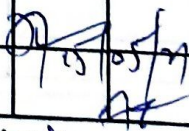

 15/05/21
 JE


 15.05.21
 JE

Material Statement.

①	E/w.			897.75 m ³
②	Stone aggregates & screening			63.00 m ³
③	Emulsion.			0.096 M.T.
④	B.Numen.			0.684 M.T.


 15.05.21
 JE


 15/05/21
 JE

Continuation