

Name of work : Sultanganj Tarapur Devghar Path Ladaua Mod (Bikrampur) Se
Amaiya Pat

Name of customer : S. B. Engicon Pvt.Ltd.

(R)Rural Road

Date		Time		Test No	Distance(m)	Total Distance(m)	Good		Average				Poor				Remarks
							< 4000		4001 - 5000		> 5000						
BUMP(cm)	Speed(Km/Hr)	UJ(mm/Km)	Corrected UJ (mm/Km)	IRI	Status	Latitude	Direction	Longitude	Direction1								
29/12/24	12:20:06	77	100	100	29.0 cm	11.2 Km/Hr	2900.0 mm/Km	3035	4.07	Good	25.1779712	N	86.6421963	E	Normal		
29/12/24	12:20:25	77	100	200	24.0 cm	17.4 Km/Hr	2400.0 mm/Km	2550	3.49	Good	25.1789993	N	86.6420085	E	Normal		
29/12/24	12:20:56	77	100	300	26.0 cm	10.2 Km/Hr	2600.0 mm/Km	2744	3.72	Good	25.1795781	N	86.6424248	E	Normal		
29/12/24	12:21:20	77	100	400	24.0 cm	14.0 Km/Hr	2400.0 mm/Km	2550	3.49	Good	25.1802823	N	86.6421915	E	Normal		
29/12/24	12:21:33	77	100	500	26.0 cm	23.1 Km/Hr	2600.0 mm/Km	2744	3.72	Good	25.1808591	N	86.6428593	E	Normal		
29/12/24	12:21:55	77	100	600	23.0 cm	16.5 Km/Hr	2300.0 mm/Km	2454	3.37	Good	25.1812932	N	86.6423428	E	Normal		
29/12/24	12:22:16	77	100	700	21.0 cm	17.3 Km/Hr	2100.0 mm/Km	2260	3.13	Good	25.1814565	N	86.6413813	E	Normal		
29/12/24	12:22:38	77	100	800	24.0 cm	17.1 Km/Hr	2400.0 mm/Km	2550	3.49	Good	25.1817112	N	86.6404361	E	Normal		
29/12/24	12:22:59	77	100	900	26.0 cm	16.4 Km/Hr	2600.0 mm/Km	2744	3.72	Good	25.1818850	N	86.6394464	E	Normal		
29/12/24	12:23:20	77	100	1000	27.0 cm	18.1 Km/Hr	2700.0 mm/Km	2841	3.84	Good	25.1822502	N	86.6390461	E	Normal		
29/12/24	12:23:41	77	100	1100	25.0 cm	17.8 Km/Hr	2500.0 mm/Km	2647	3.6	Good	25.1831113	N	86.6392945	E	Normal		
29/12/24	12:23:58	77	100	1200	23.0 cm	19.1 Km/Hr	2300.0 mm/Km	2454	3.37	Good	25.1839946	N	86.6395282	E	Normal		
29/12/24	12:24:17	77	100	1300	28.0 cm	25.3 Km/Hr	2800.0 mm/Km	2938	3.95	Good	25.1848632	N	86.6397635	E	Normal		
29/12/24	12:24:35	77	100	1400	25.0 cm	24.2 Km/Hr	2500.0 mm/Km	2647	3.6	Good	25.1857564	N	86.6401037	E	Normal		
29/12/24	12:24:53	77	100	1500	27.0 cm	23.1 Km/Hr	2700.0 mm/Km	2841	3.84	Good	25.1865701	N	86.6403542	E	Normal		
29/12/24	12:25:12	77	100	1600	24.0 cm	25.5 Km/Hr	2400.0 mm/Km	2550	3.49	Good	25.1873642	N	86.6402548	E	Normal		
29/12/24	12:25:32	77	100	1700	29.0 cm	17.9 Km/Hr	2900.0 mm/Km	3035	4.07	Good	25.1874825	N	86.6392801	E	Normal		
29/12/24	12:25:51	77	100	1800	27.0 cm	19.2 Km/Hr	2700.0 mm/Km	2841	3.84	Good	25.1877288	N	86.6383277	E	Normal		
29/12/24	12:26:11	77	100	1900	25.0 cm	18.9 Km/Hr	2600.0 mm/Km	2744	3.72	Good	25.1880185	N	86.6374303	E	Normal		
29/12/24	12:26:29	77	100	2000	28.0 cm	17.8 Km/Hr	2800.0 mm/Km	2938	3.95	Good	25.1888923	N	86.6375762	E	Normal		
29/12/24	12:26:49	77	100	2100	32.0 cm	18.0 Km/Hr	3200.0 mm/Km	3326	4.42	Good	25.1896281	N	86.6380184	E	Speed Breaker		

Handwritten signature and date 29/12/24

Name of work : Sullanganj Tarapur Devghar Path Ladaua Mod (Bikrampur) Se
Amaya Pat


Name of customer : S. B. Engicon Pvt.Ltd.

(R)Rural Road

Good		Average		Poor	
< 4000		4001 - 5000		> 5000	
29/12/24	12:27:20	77	100	2200	30.0 cm
29/12/24	12:27:41	77	100	2300	27.0 cm
					10.2 Km/Hr
					10.7 Km/Hr
					3000.0 mm/Km
					2700.0 mm/Km
					3132
					4.19
					Good
					25.1903863
					N
					88.6377475
					E
					88.6381114
					E
					Normal

29/12/24
21/12/24
20/12/24

Name of Customer: S. B. Engicon Pvt.Ltd. , Machine no: 19213 , Road: Sultangauj Tarapur Devghar Path Ladaua Mod (Bikrampur) Se Amaiya Pat , Date: 29-12-24 , Section No: 77 , Equation: $Y=0.969X+224.9$

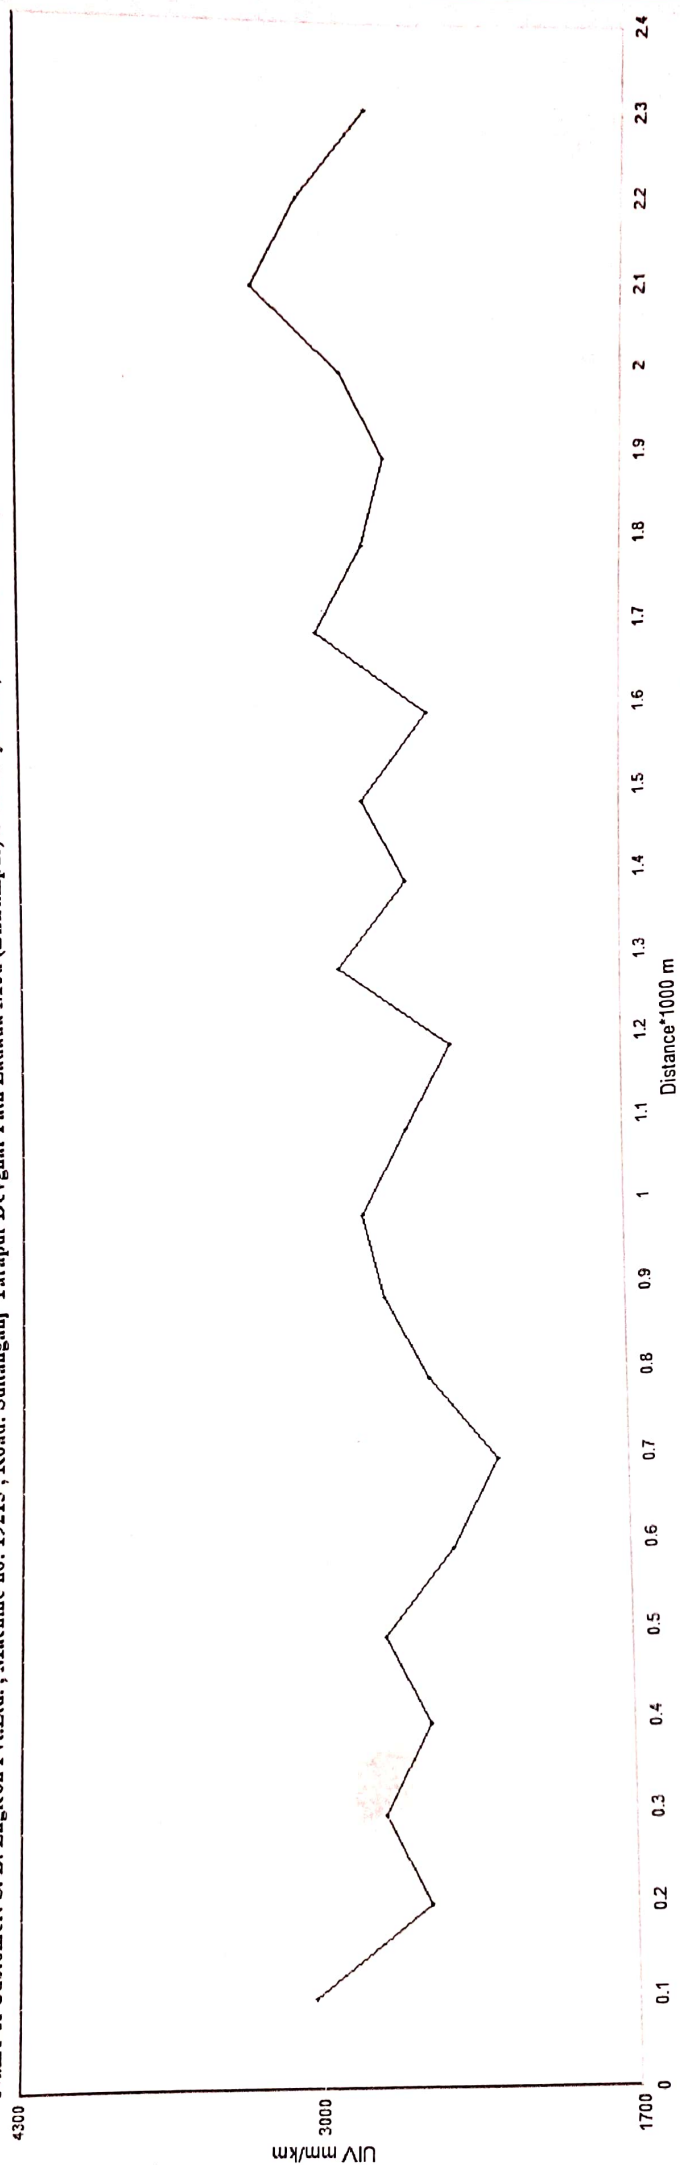

[Handwritten signature]
07/01/25
EE